



# PATRICK'S PROPERTY MAINTENANCE SERVICE

619 818 3882

patrick@3einspect.com



PHASE 1 PRE-721 EVALUATION BUILDING 2 UNITS 7-50

1234 Main Street  
Imperial Beach, CA 91932-1412

Buyer Name  
01/11/2025 9:00AM



Agent

Agent Name  
555-555-5555  
agent@spectora.com

---

# TABLE OF CONTENTS

1: What to Expect	5
2: Limitations	6
3: Reference Information	7
4: Property Overview	9
5: Building 2: Exterior Elevated Element (E3) Group	11
6: Building 2: Balconies	38

# SUMMARY

38

PASS

22

NON-EMERGENCY REPAIRS  
REQUIRED

- ⊖ 5.1.1 Building 2: Exterior Elevated Element (E3) Group - Overall Condition Evaluation: Marginal Condition
- 🔧 5.2.1 Building 2: Exterior Elevated Element (E3) Group - East Walkway: Openings in Waterproofing
- 🔧 5.2.2 Building 2: Exterior Elevated Element (E3) Group - East Walkway: Corrosion
- 🔧 5.2.3 Building 2: Exterior Elevated Element (E3) Group - East Walkway: Damaged Stucco
- 🔧 5.3.1 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Openings in Waterproofing
- ⊖ 5.3.2 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Corrosion
- 🔧 5.3.3 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Corrosion 2
- 🔧 5.3.4 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Damaged Stucco
- 🔧 5.3.5 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Unsealed Connection(s)
- ⊖ 5.3.6 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Support Construction
- 🔧 5.3.7 Building 2: Exterior Elevated Element (E3) Group - North Walkway: Termite/Wood Rot Damage
- 🔧 5.4.1 Building 2: Exterior Elevated Element (E3) Group - Northeast Stairway: Damaged Precast Tread(s)
- 🔧 5.4.2 Building 2: Exterior Elevated Element (E3) Group - Northeast Stairway: Damaged Stucco
- 🔧 5.4.3 Building 2: Exterior Elevated Element (E3) Group - Northeast Stairway: Openings in Waterproofing
- 🔧 5.5.1 Building 2: Exterior Elevated Element (E3) Group - Middle Stairway: Damaged Precast Tread(s)
- 🔧 5.5.2 Building 2: Exterior Elevated Element (E3) Group - Middle Stairway: Openings in Waterproofing
- ⊖ 5.5.3 Building 2: Exterior Elevated Element (E3) Group - Middle Stairway: Damaged Support Structure
- 🔧 5.5.4 Building 2: Exterior Elevated Element (E3) Group - Middle Stairway: Termite/Wood Rot Damage
- 🔧 5.6.1 Building 2: Exterior Elevated Element (E3) Group - Northwest Stairway: Damaged Precast Tread(s)
- 🔧 5.6.2 Building 2: Exterior Elevated Element (E3) Group - Northwest Stairway: Openings in Waterproofing
- 🔧 5.7.1 Building 2: Exterior Elevated Element (E3) Group - West Walkway: Damaged Stucco
- 🔧 5.7.2 Building 2: Exterior Elevated Element (E3) Group - West Walkway: Openings in Waterproofing
- ⊖ 5.7.3 Building 2: Exterior Elevated Element (E3) Group - West Walkway: Corrosion
- 🔧 5.7.4 Building 2: Exterior Elevated Element (E3) Group - West Walkway: Unsealed Connection(s)
- ⊖ 6.1.1 Building 2: Balconies - Overall Condition Evaluation: Marginal Condition
- 🔧 6.2.1 Building 2: Balconies - Apt. 8 Balcony : Openings in Waterproofing
- ⊖ 6.2.2 Building 2: Balconies - Apt. 8 Balcony : Missing or loose Fastener(s)

- 🔧 6.2.3 Building 2: Balconies - Apt. 8 Balcony : Support Construction
- ⊖ 6.3.1 Building 2: Balconies - Apt. 10 Balcony : Missing or loose Fastener(s)
- 🔧 6.4.1 Building 2: Balconies - Apt. 12 Balcony : Openings in Waterproofing
- ⊖ 6.4.2 Building 2: Balconies - Apt. 12 Balcony : Missing or loose Fastener(s)
- 🔧 6.5.1 Building 2: Balconies - Apt. 14 Balcony : Damaged Stucco
- ⊖ 6.5.2 Building 2: Balconies - Apt. 14 Balcony : Missing or loose Fastener(s)
- ⊖ 6.6.1 Building 2: Balconies - Apt. 16 Balcony : Missing or loose Fastener(s)
- ⊖ 6.7.1 Building 2: Balconies - Apt. 18 Balcony : Missing or loose Fastener(s)
- ⊖ 6.8.1 Building 2: Balconies - Apt. 20 Balcony 1: Missing or loose Fastener(s)
- 🔧 6.9.1 Building 2: Balconies - Apt. 20 Balcony 2: Openings in Waterproofing
- 🔧 6.9.2 Building 2: Balconies - Apt. 20 Balcony 2: Unsealed Connection(s)
- ⊖ 6.9.3 Building 2: Balconies - Apt. 20 Balcony 2: Missing or loose Fastener(s)
- 🔧 6.10.1 Building 2: Balconies - Apt. 22 Balcony : Openings in Waterproofing
- 🔧 6.11.1 Building 2: Balconies - Apt. 24 Balcony : Openings in Waterproofing
- ⊖ 6.11.2 Building 2: Balconies - Apt. 24 Balcony : Missing or loose Fastener(s)
- ⊖ 6.12.1 Building 2: Balconies - Apt. 26 Balcony : Missing or loose Fastener(s)
- 🔧 6.13.1 Building 2: Balconies - Apt. 28 Balcony : Unsealed Connection(s)
- ⊖ 6.13.2 Building 2: Balconies - Apt. 28 Balcony : Missing or loose Fastener(s)
- 🔧 6.14.1 Building 2: Balconies - Apt. 30 Balcony : Openings in Waterproofing
- ⊖ 6.14.2 Building 2: Balconies - Apt. 30 Balcony : Missing or loose Fastener(s)
- 🔧 6.15.1 Building 2: Balconies - Apt. 32 Balcony : Damaged Stucco
- 🔧 6.15.2 Building 2: Balconies - Apt. 32 Balcony : Openings in Waterproofing
- ⊖ 6.15.3 Building 2: Balconies - Apt. 32 Balcony : Corrosion
- 🔧 6.16.1 Building 2: Balconies - Apt. 34 Balcony : Openings in Waterproofing
- ⊖ 6.16.2 Building 2: Balconies - Apt. 34 Balcony : Missing or loose Fastener(s)
- 🔧 6.17.1 Building 2: Balconies - Apt. 36 Balcony : Openings in Waterproofing
- 🔧 6.17.2 Building 2: Balconies - Apt. 36 Balcony : Unsealed Connection(s)
- 🔧 6.18.1 Building 2: Balconies - Apt. 38 Balcony 1: Openings in Waterproofing
- ⊖ 6.18.2 Building 2: Balconies - Apt. 38 Balcony 1: Corrosion
- 🔧 6.18.3 Building 2: Balconies - Apt. 38 Balcony 1: Unsealed Connection(s)
- 🔧 6.19.1 Building 2: Balconies - Apt. 38 Balcony 2: Damaged Stucco
- 🔧 6.19.2 Building 2: Balconies - Apt. 38 Balcony 2: Openings in Waterproofing
- ⊖ 6.19.3 Building 2: Balconies - Apt. 38 Balcony 2: Missing or loose Fastener(s)

# 1: WHAT TO EXPECT

## Information

---

### Phase 1

#### **Pre-721 Evaluation (P1PE) Service:**

This service is designed to provide a comprehensive initial assessment of Exterior Elevated Elements (E3s) in multi-unit properties. This service includes:

- Identification and photographic documentation of all E3s to be inspected.
- Highlighting and documentation of areas of potential concern that may require further evaluation.
- Recommendations for additional detailed assessments to ensure compliance with SB-721 regulations.
- Early identification of necessary repairs prior to the SB-721 inspection.
- Advising on routine maintenance items to prolong the lifespan and safety of E3s.

## 2: LIMITATIONS

### Information

---

#### Phase 1

##### Phase 1 - Pre-721 Evaluation Limitations

Please be aware that the Phase 1 Pre-721 Evaluation (P1PE) is the initial step in the SB-721 compliance process and is **NOT a complete SB-721 inspection**. The limitations of the P1PE include:

- The P1PE is primarily a visual inspection and does not encompass a detailed analysis as required by SB-721. It focuses on basic function and safety rather than detailed Code Compliance.
- This evaluation does not involve borescope inspection or projections about future performance. It is not designed to cover every detail according to manufacturer specifications or current and past construction codes.
- The P1PE report is based on observable conditions at the time of the evaluation and does not include the inspection of concealed or difficult-to-inspect components. Cosmetic conditions are also excluded.
- This evaluation does not include detailed testing for hidden wood decay or for the presence of insects and vermin.
- The P1PE report is an advisory document and should not be regarded as a warranty or guarantee of the property's condition. Patrick's Property Maintenance Service is not liable for undetected or unreported issues or for any costs arising from such issues.
- Patrick's Property Maintenance Service assumes no liability beyond the cost of the report for mistakes, omissions, or errors in judgment. We are not liable for the cost of repairing or replacing any unreported defects or conditions.
- The report and findings are prepared exclusively for the client's use. Liability for decisions or actions taken based on the report does not extend to third parties.

## 3: REFERENCE INFORMATION

### Information

---

For information about our services and pricing, please visit the following hyperlink: [Services and Pricing](#)

For information about our standards of practice, please visit the following hyperlink: [SOP](#)

### Glossary of Terms

**"Exterior Elevated Element (E3)"** refers to balconies, decks, porches, stairways, walkways, and entry structures extending beyond a building's exterior walls. These structures have a walking surface elevated more than six feet above ground level, are designed for human occupancy or use, and rely significantly on wood or wood-based products for structural support or stability.

**"Associated Waterproofing Elements"** include flashings, membranes, coatings, and sealants that protect the load-bearing components of elevated exterior structures from water and elemental exposure.

**"Load-Bearing Components"** are elements extending beyond the building's exterior walls, transferring structural loads from the elevated exterior structure to the building.

**"Borescope"** refers to an optical tool used for inspecting inaccessible areas. It consists of a tube, either rigid or flexible, with a display and camera connected by an optical or electrical system, facilitating visual examination of narrow spaces.

**"Cantilever Beams"** are rigid structural element that extends horizontally and are unsupported at one end. Typically, they extend from flat vertical surfaces such as a wall, to which they must be firmly attached. A cantilever can be formed as a beam, plate, truss, or slab. When subjected to a structural load at the unsupported end, the cantilever carries the load to the support creating shear stress and a bending moment.

**"Cladding"** involves applying one material over another to create a protective or insulating layer. In construction, it is used for thermal insulation and weather resistance.

**"Doubler"** designates the junction point where stringers are attached.

**"Deck Metal"** is a type of metal flashing used around the perimeter of decks to prevent water infiltration.

**"Joist hanger"** refers to metal brackets that connect and support joists, beams, or rafters in framing systems. These hangers, typically made of aluminum, steel, or galvanized steel, anchor the ceilings, floors, and decks to the framing structure by fastening the joists or beams to the rim joists and ledger boards.

**"Ledger"** denotes a horizontal support structure affixed to a building or wall, providing support to various construction elements.

**"Standoff"** is a metal connector that elevates a wooden support beam, allowing for water drainage.

**"Stair Stringer"** is a structural component that underpins the treads and risers of a staircase. This inclined member, running along the staircase sides, acts as the staircase's backbone, bearing the weight and ensuring stability.

**"Toe Trip"** refers to a raised edge on a walking surface, usually caused by cracking or sagging of the support system, posing a trip hazard.

**"Weep Screed"** is a specific type of metal flashing located at the bottom of walls. It functions to expel moisture and establishes stucco depth and acts as a control joint in stucco walls.

## Exterior Elevated Element (E3) Group Condition Evaluations

Each E3 Group undergoes a Condition Evaluation, considering the state of each component comprising the E3 assembly. The overall condition is determined by the component in the worst condition. With the component condition determined by the component's most severe defect. The Overall Condition Evaluation determines the necessary follow-up actions for the property owner.

**Acceptable Condition - Pass:** E3 groups and their components rated as Acceptable are deemed to be functioning as intended, requiring minimal, if any, maintenance to ensure continued performance until the next inspection cycle or 6 years.

**Marginal Condition - Non-Emergency Repairs Required:** One or more components of this E3 group rated as Marginal, are deemed to be compromised and are not functioning as intended. This condition may evolve into a hazardous condition if unaddressed.

**Poor Condition - Immediate Threat to Safety:** One or more components of this E3 group rated as Poor, are deemed as structurally compromised, posing an immediate safety threat. Access to the E3 group should be restricted to prevent harm during the repair or rebuilding process. Re-inspection is required after repair completion.

## Notification and Follow-up

**Poor Condition - Immediate Threat to Safety:** The inspector will immediately notify the property owner or agent, advising them to restrict access and/or secure temporary shoring. If this rating is given during a Phase 3 SB-721 Inspection, a copy of the report must be delivered to the property owner and local building department/code enforcement within 15 days of the inspection. Enforcement of corrective action will be by local code enforcement agencies.

**Marginal Condition - Non-Emergency Repairs Required:** Delivery of phase 1 pre-inspection will serve as notification from the inspector and will contain maintenance advice for items requiring non-emergency repairs. If this rating is given during a Phase 3 SB-721 Inspection, a copy of the report must be delivered to the owner or agent within 45 days of the inspection. The property owner must obtain necessary permits for repairs within 120 days of receiving the report and complete the repairs within 120 days of receiving their permit. If compliance is not met within 180 days, the inspector shall notify the local enforcement agency and the building owner. A civil penalty may be assessed if repairs are not completed within 30 days of notice.

**Acceptable Condition - Pass:** No action is required of the property owner on receiving this rating, regardless of inspection phase. Inspector must deliver the report to the owner or agent within 45 days of the inspection. No corrective repairs are required, but regular observation and maintenance of the E3 is advised. The property owner must keep a copy of the completed SB721 Inspection report (Phase 3) for 2 inspection cycles (12 years).



# 4: PROPERTY OVERVIEW

## Information

### \*Front of Property

Southwest Facing

The aim of this image is to inform the viewer of this report the closest direction the front of the property faces. Understanding the orientation of the property assists in accurately referencing positions of the defect callouts mentioned in the following report.



### Applicability of SB-721

Applicable

The property contains at least a single building with three or more multifamily dwelling units with exterior elevated elements at least 6 feet off of the ground. These elements utilize load bearing components based on wood or wood-based products.

### Property Description

This property is a 3 building apartment complex built in 1970. The buildings will be referred to as B1 for units 1 through 6, B2 for units 7 through 50, and B3 for units 51 through 56.

### Map of Property



### Exterior Images

These images show the exterior of the building or buildings, helping the viewer understand the property's layout.



# 5: BUILDING 2: EXTERIOR ELEVATED ELEMENT (E3) GROUP

5.1	Overall Condition Evaluation
5.2	East Walkway
5.3	North Walkway
5.4	Northeast Stairway
5.5	Middle Stairway
5.6	Northwest Stairway
5.7	West Walkway

## Information

### Inspection Images Description

The following photographs illustrate the inspector's recorded observations of the E3 components' condition at the time of inspection. These images serve solely for identification and illustrative purposes and should not be interpreted as a comprehensive guide for defining the extent of necessary maintenance or repairs. They may not encompass all areas of the E3 requiring attention. For any emergency or non-emergency repairs, it is recommended to consult with a licensed and experienced General Contractor. A thorough review of the SB721 Inspection Report by such a contractor, followed by an on-site evaluation, is essential to accurately establish the required scope of work and ensure that repairs are effectively addressed.

### \*Orientation Images

Stairway, Landing, Walkway





**East Walkway: Approximate Height**  
9 ft


**East Walkway: Walking Surface Material**  
Composite

**East Walkway: Rail Material**  
Steel

**East Walkway: Support Material**  
Wood

**East Walkway: \*Walkway Inspection Image(s)**




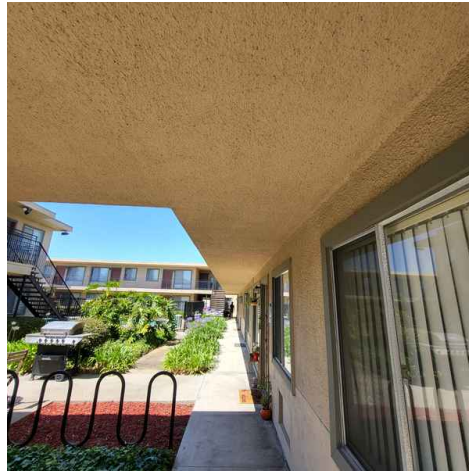


**North Walkway: Approximate Height**  
9 ft

**North Walkway: Walking Surface Material**  
Composite

**North Walkway: Support Material**  
Wood

**North Walkway: \*Walkway Inspection Image(s)**

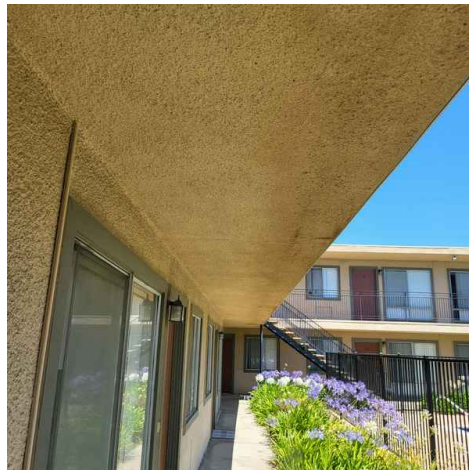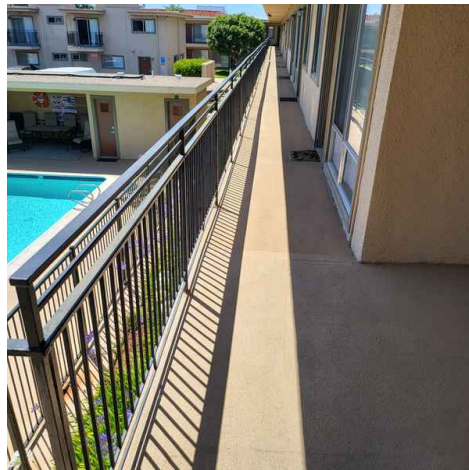

**Northeast Stairway: Approximate Height**  
9 ft

**Northeast Stairway: Number of Treads**  
16

**Northeast Stairway: Rail Material**  
Steel

**Northeast Stairway: Stringer Material**  
Steel

**Northeast Stairway: Tread material**  
Precast Concrete

**Northeast Stairway: \*Stairway Inspection Image(s)**

**Middle Stairway: Approximate Height**  
9 ft

**Middle Stairway: Number of Treads**

15

**Middle Stairway: Rail Material**  
Steel

**Middle Stairway: Tread material**  
Precast Concrete

**Middle Stairway: Stringer Material**  
Steel

**Middle Stairway: \*Stairway Inspection Image(s)**



**Northwest Stairway: Approximate Height**  
9 ft


**Northwest Stairway: Number of Treads**  
16


**Northwest Stairway: Rail Material**  
Steel

**Northwest Stairway: Stringer Material**  
Steel

**Northwest Stairway: Tread material**  
Precast Concrete

**Northwest Stairway: \*Stairway Inspection Image(s)**

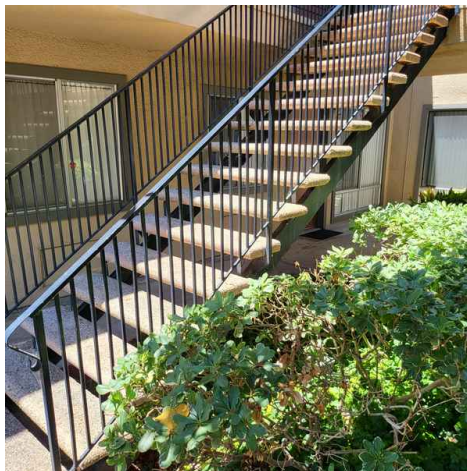

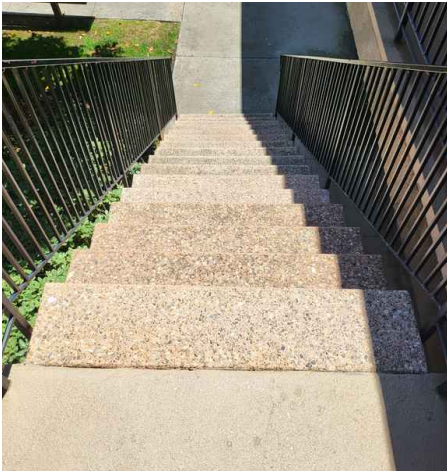

**West Walkway: Approximate Height**  
9 ft

**West Walkway: Walking Surface Material**  
Composite

**West Walkway: Rail Material**  
Steel

**West Walkway: Support Material**  
Wood

**West Walkway: \*Walkway Inspection Image(s)**



## Condition evaluation

## 5.1.1 Overall Condition Evaluation

**MARGINAL CONDITION**

Non-Emergency Repairs Required

**Marginal Condition - Non-Emergency Repairs Required:**

One or more components of this E3 group rated as Marginal, are deemed to be compromised and are not functioning as intended. This condition may evolve into a hazardous condition if unaddressed. The overall condition is determined by the component in the worst condition.

## Recommendation

Contact a qualified professional.



5.2.1 East Walkway







**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.

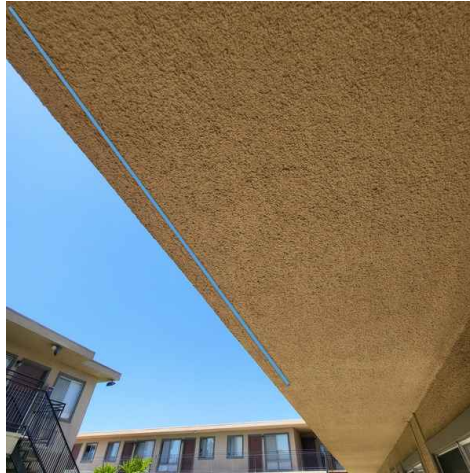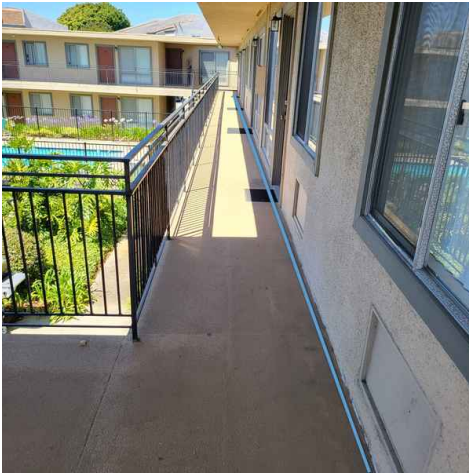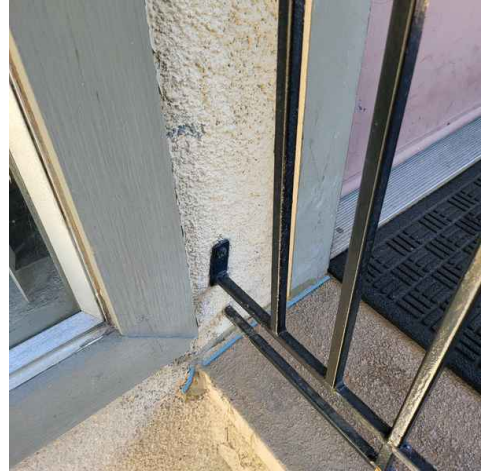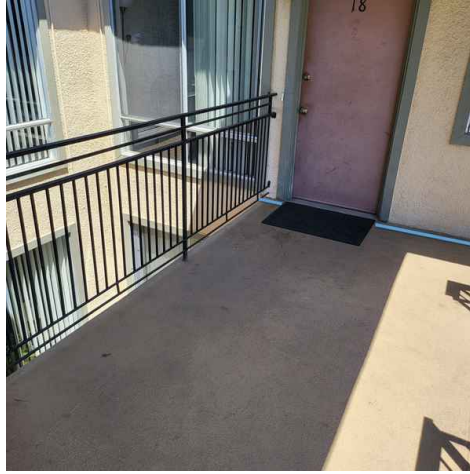



5.2.2 East Walkway




**CORROSION**



Minor - There is surface corrosion. The affected area(s) should be repaired.

Recommendation

Contact a qualified professional.

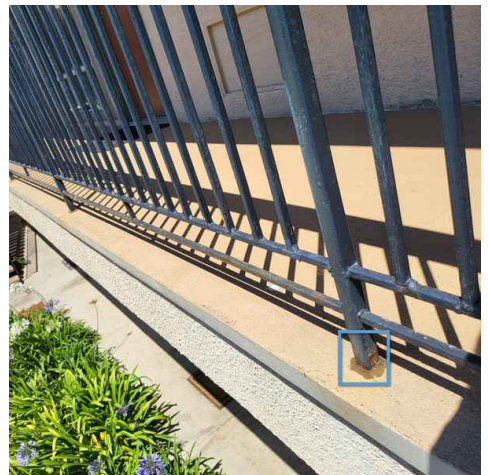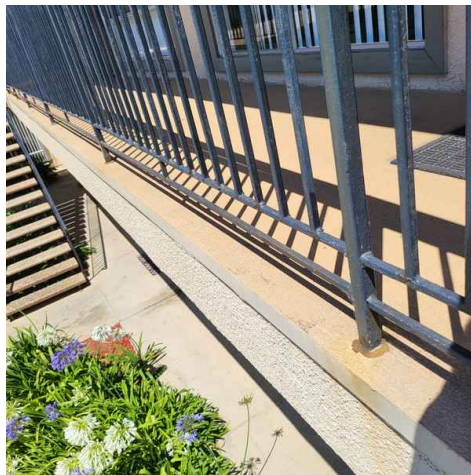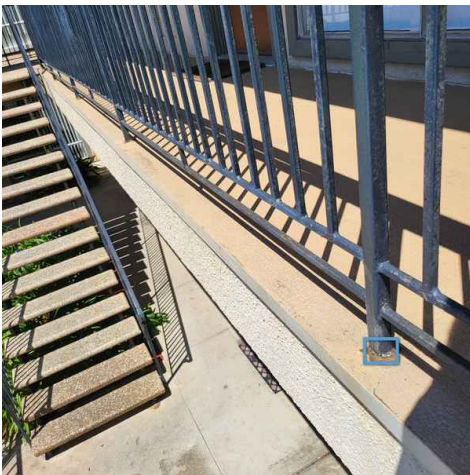

5.2.3 East Walkway



**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Recommendation

Contact a qualified professional.



Discolored

5.3.1 North Walkway





**OPENINGS IN WATERPROOFING**


Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.


Recommendation

Contact a qualified professional.

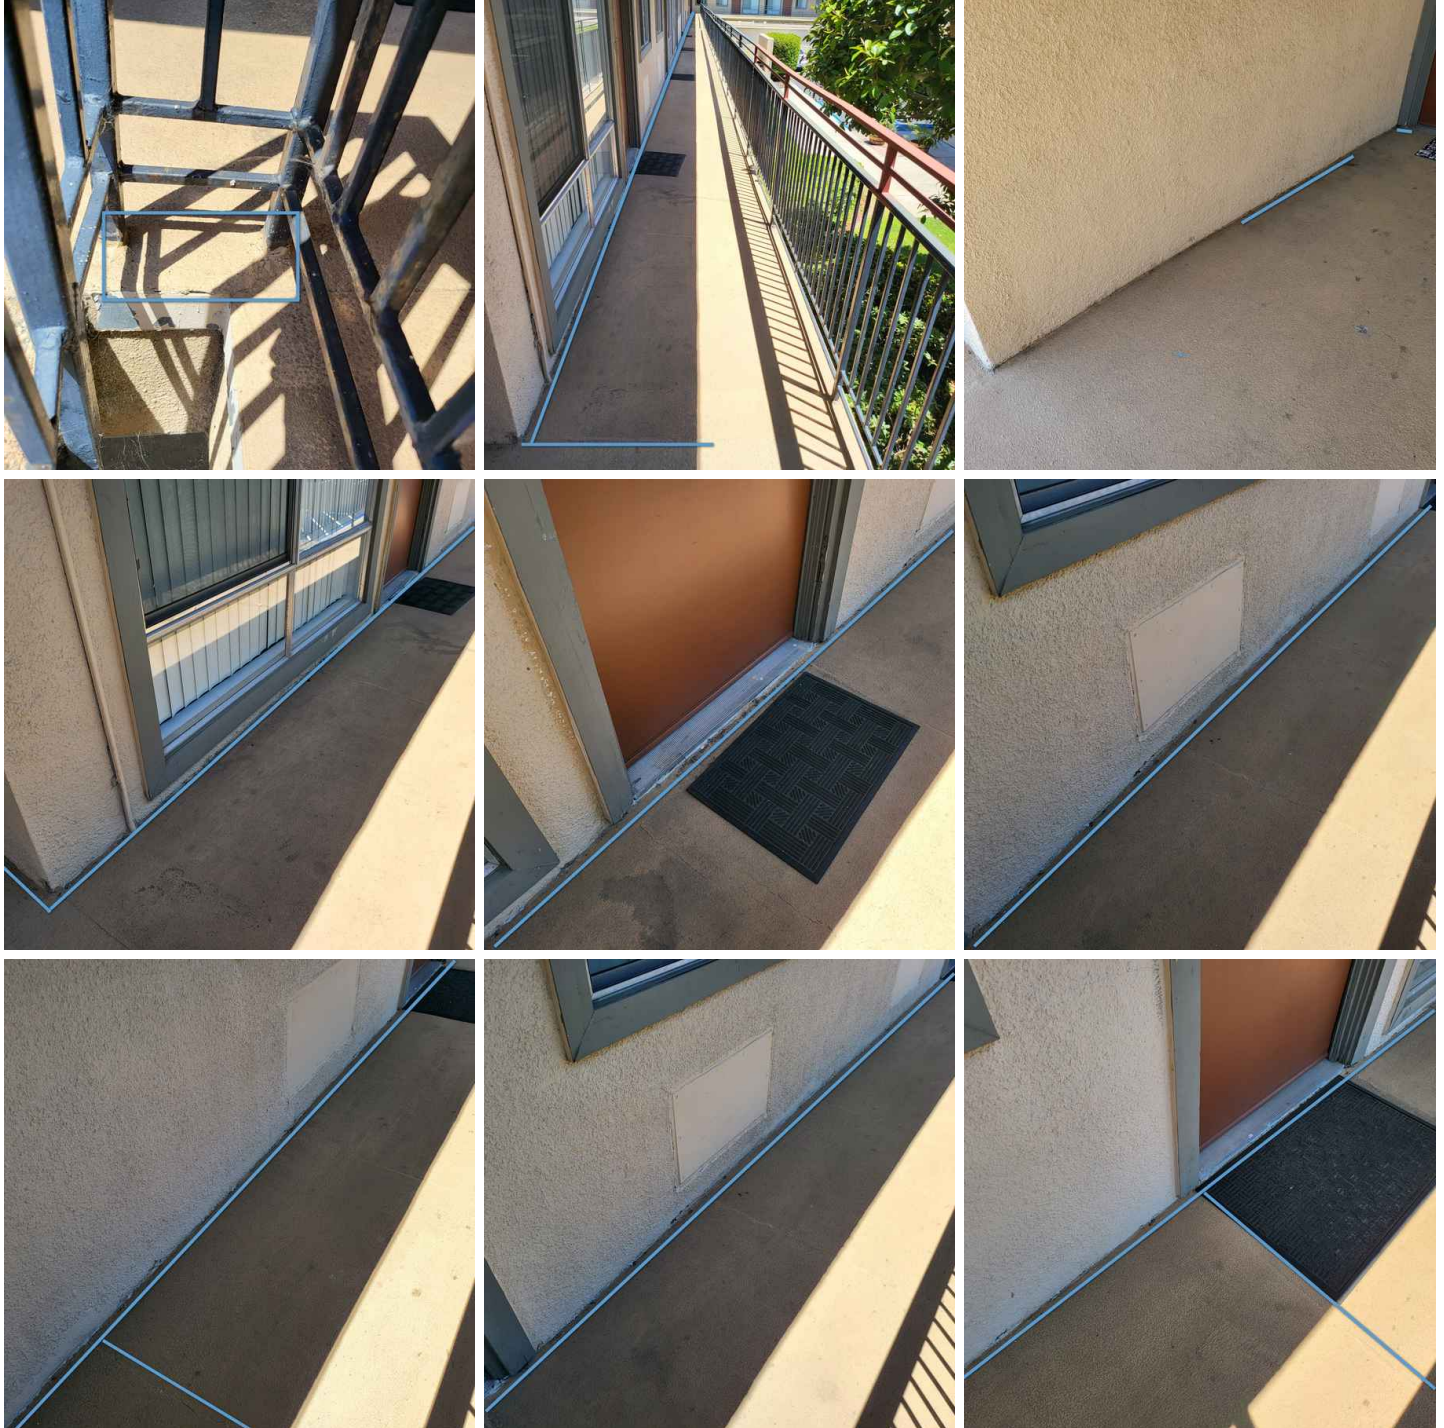

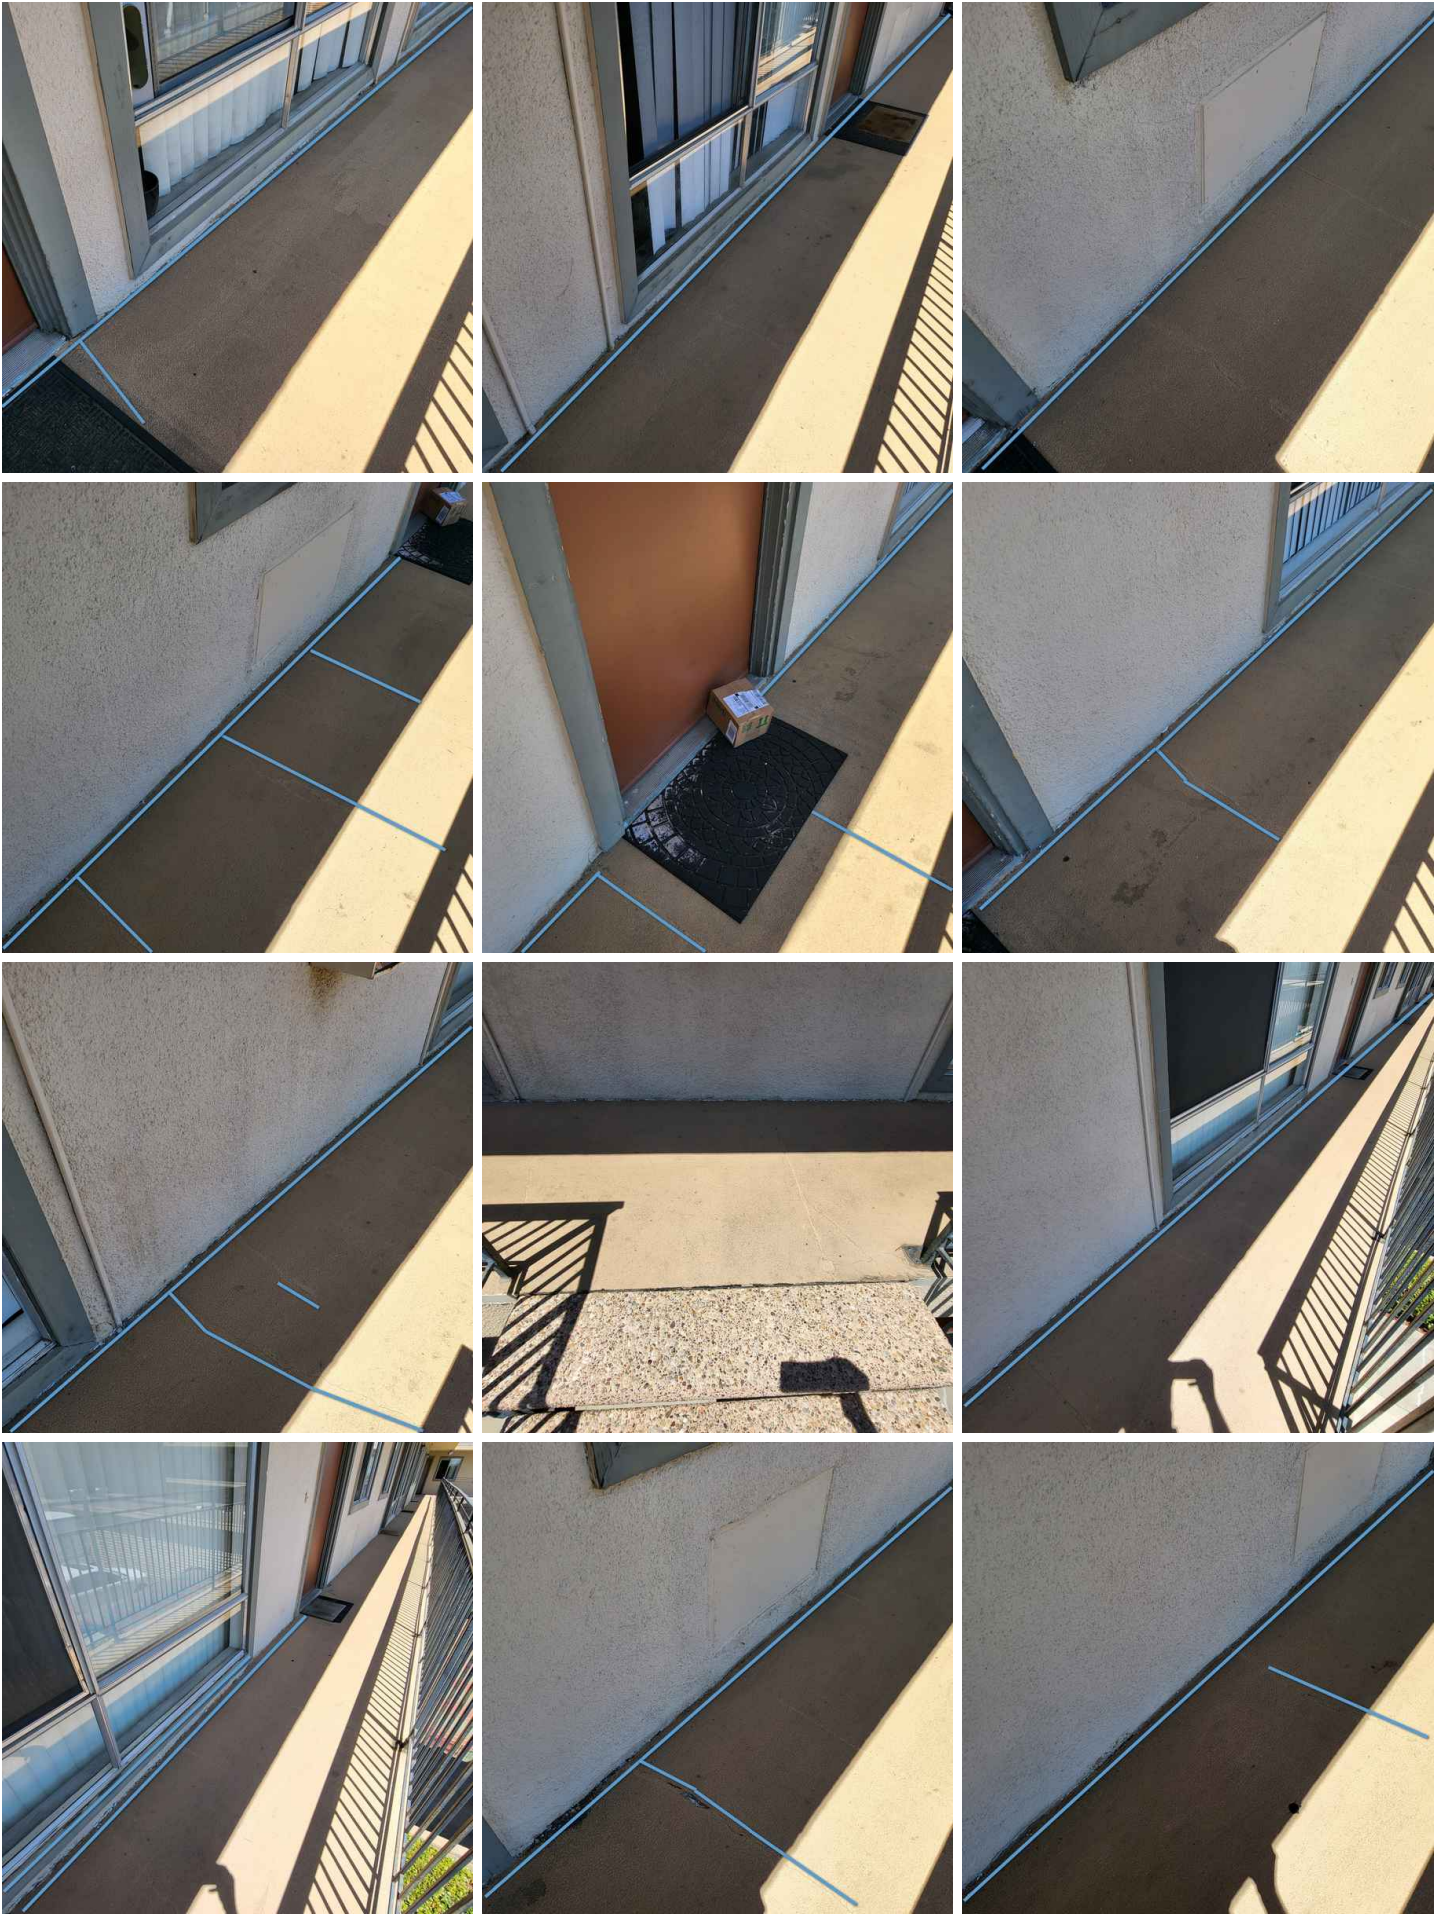

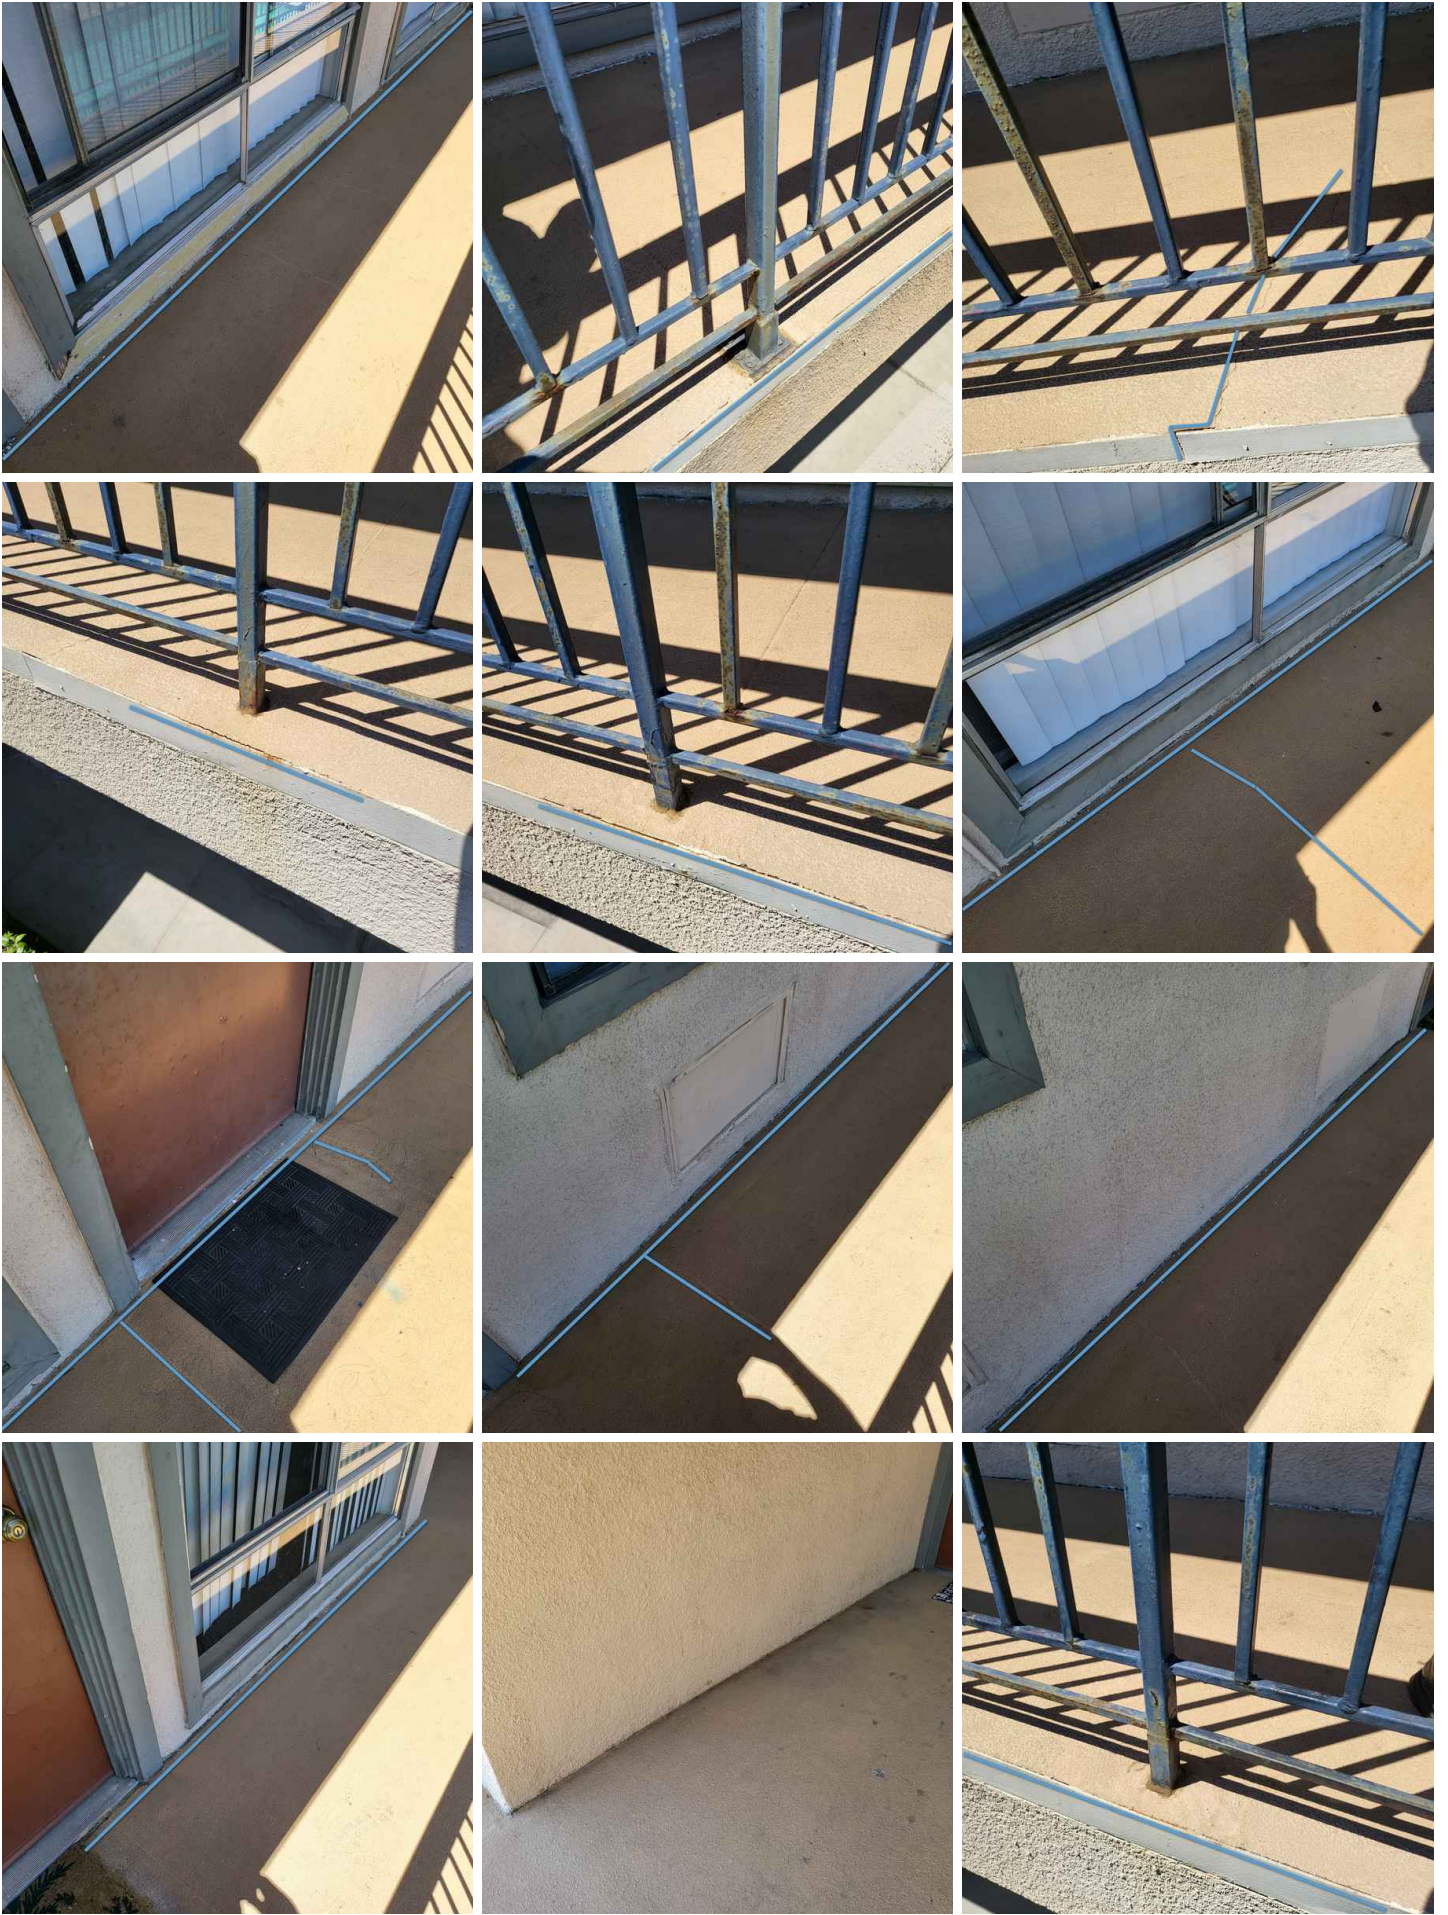

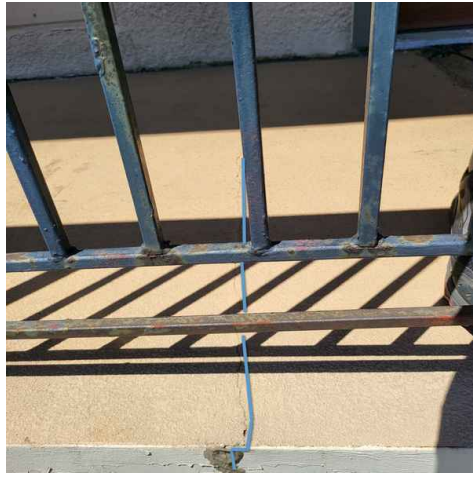

5.3.2 North Walkway

Non-Emergency Repairs Required

**CORROSION**



Minor - There is surface corrosion. The affected area(s) should be repaired.

Marginal - There is significant corrosion that is affecting structural integrity. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Severe - There is significant corrosion that is severely affecting structural integrity. This condition should be addressed immediately. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Poor.

Recommendation

Contact a qualified professional.

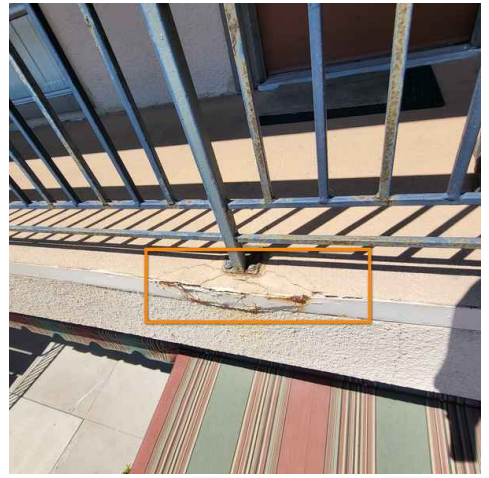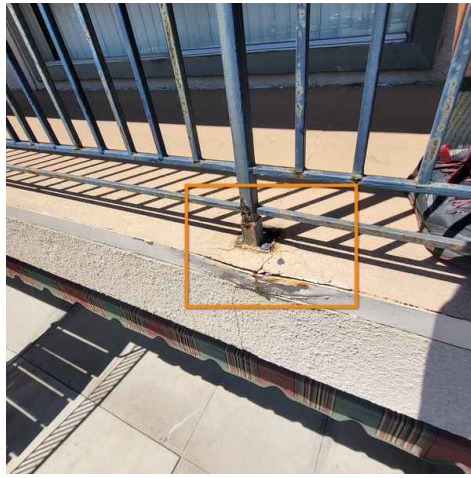



## 5.3.3 North Walkway

**CORROSION 2**

Minor - There is surface corrosion. The affected area(s) should be repaired.

Marginal - There is significant corrosion that is affecting structural integrity. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Severe - There is significant corrosion that is severely affecting structural integrity. This condition should be addressed immediately. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Poor.

Recommendation

Contact a qualified professional.



5.3.4 North Walkway




**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Marginal - Stucco is cracking, stained, bulging, bubbling, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These conditions are marginal. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to determine the extent of any water damage via borescope inspection or larger investigative openings, and to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Recommendation

Contact a qualified professional.

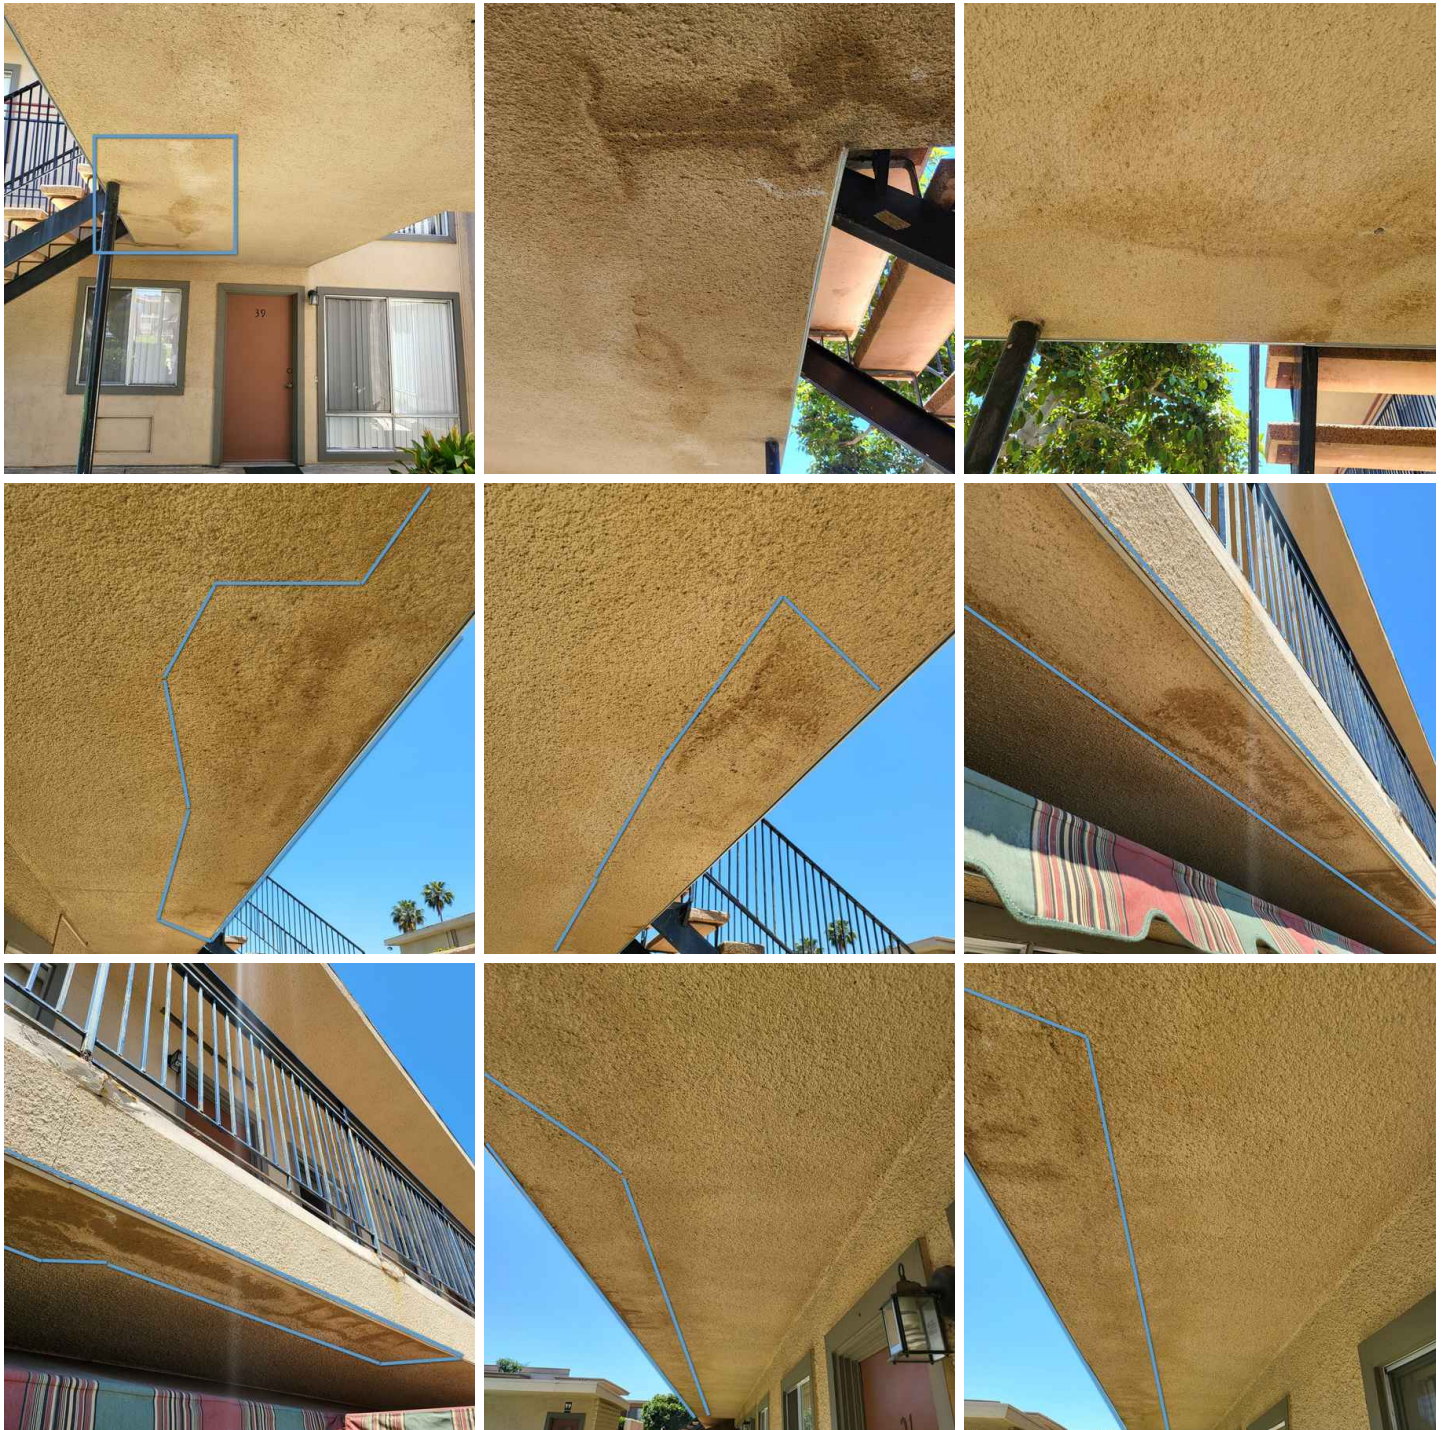



5.3.5 North Walkway

**UNSEALED CONNECTION(S)**





WHERE THE RAILING ATTACHES TO THE STAIR TREAD.

There are unsealed connections. Lack of proper sealing at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.

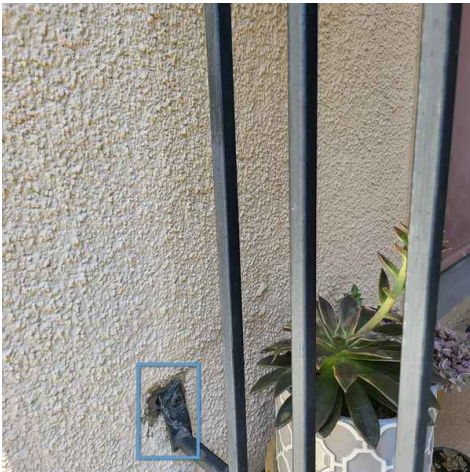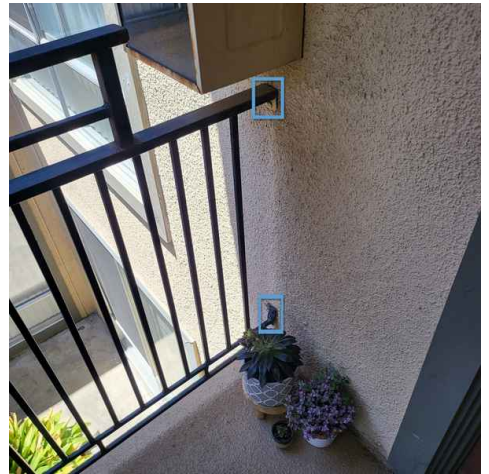

5.3.6 North Walkway

 Non-Emergency Repairs Required


**SUPPORT CONSTRUCTION**

Marginal - The inspection revealed inadequate or improper construction, or evidence of instability in the support structure. This condition suggests that the support construction may not adhere to regulatory standards, potentially leading to long-term issues. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow-Up - Marginal.

Note: Railing is unstable.

Recommendation

Contact a qualified professional.

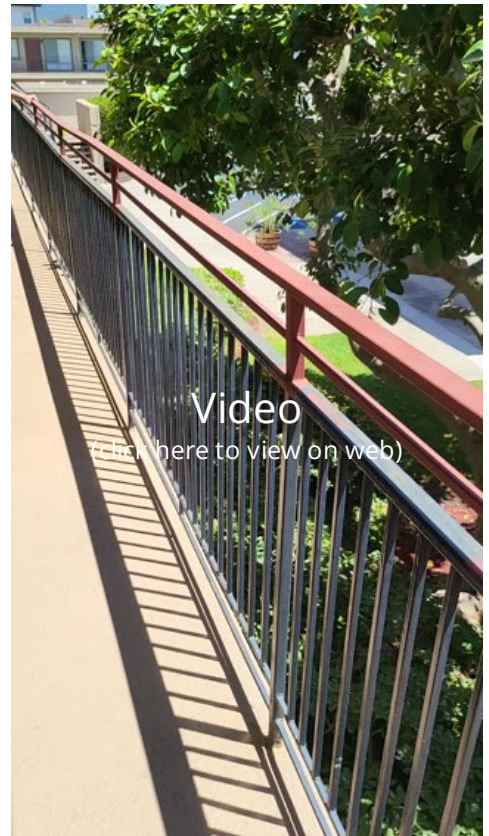

5.3.7 North Walkway


 Pass

**TERMITE/WOOD ROT DAMAGE**

Minor - There is minor evidence of wood boring insect intrusion and/or wood rot which may include bore-holes or tunnels, pellets and droppings, weakness, softness, live insects, discoloration, crumbling texture, or fungal growth. These condition(s) are minor, the affected components should be treated or replaced.

Recommendation

Contact a qualified professional.

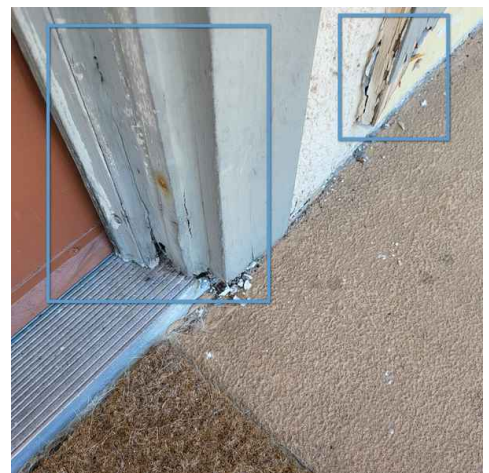

5.4.1 Northeast Stairway



**DAMAGED PRECAST TREAD(S)**

Minor - Approximately 7 of 16 treads are cracked or broken. The affected stair treads appear to be the same age and are approaching the end of their service life, at a minimum the effected treads should be replaced, if not replaced a reinspection is recommended in two years.

Recommendation

Contact a qualified professional.



5.4.2 Northeast Stairway




**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Recommendation

Contact a qualified professional.

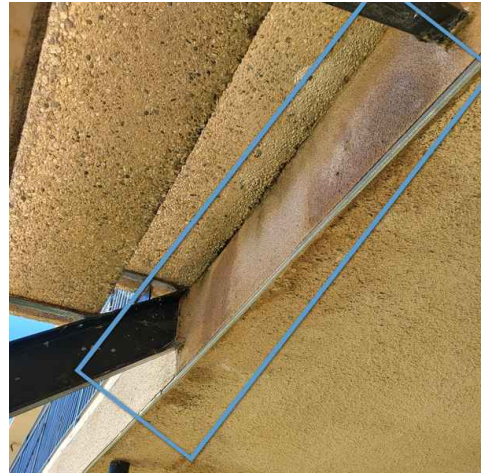

Staining

5.4.3 Northeast Stairway




**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.

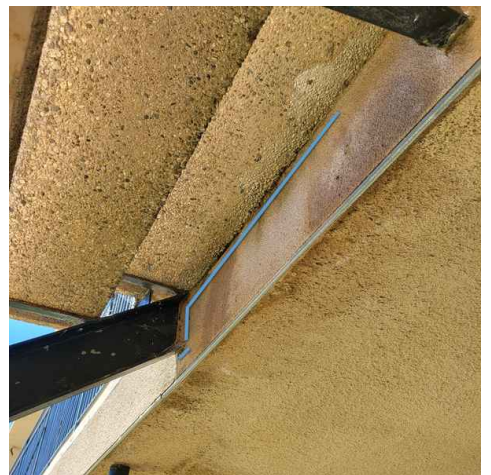

5.5.1 Middle Stairway




**DAMAGED PRECAST TREAD(S)**

Minor - Approximately 7 of 15 treads are cracked or broken. The affected stair treads appear to be the same age and are approaching the end of their service life, at a minimum the effected treads should be replaced, if not replaced a reinspection is recommended in two years.

Recommendation

Contact a qualified professional.

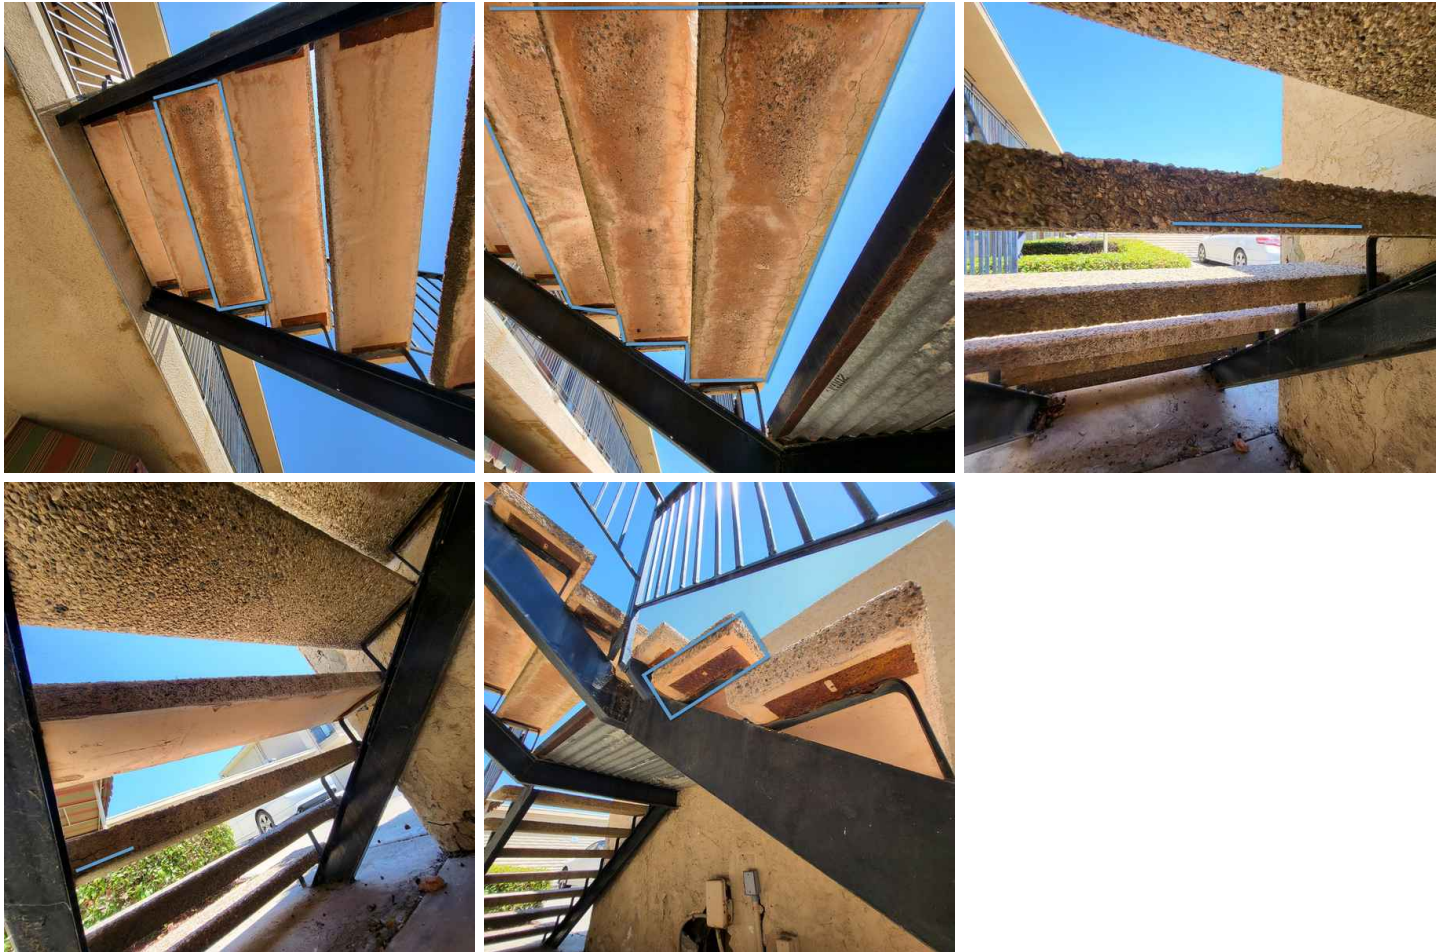

## 5.5.2 Middle Stairway

**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Marginal - There are cracks, openings, or penetrations in the waterproofing that suggest significant water intrusion. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to determine the extent of any water damage via borescope inspection or larger investigative openings, and to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

## Recommendation

Contact a qualified professional.





5.5.3 Middle Stairway

 Non-Emergency Repairs Required


**DAMAGED SUPPORT STRUCTURE**

Marginal - There is damage to the support structure which may include sagging, bowing, cracks, warping, splitting, shifting, leaning, falling. These condition(s) are significant and suggest that the integrity of the support structure may be compromised. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Severe - There is major damage to the support structure which may include sagging, bowing, cracks, warping, splitting, shifting, leaning, falling. These condition(s) are severe and the integrity of the support structure is compromised. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Poor.

Recommendation

Contact a qualified professional.

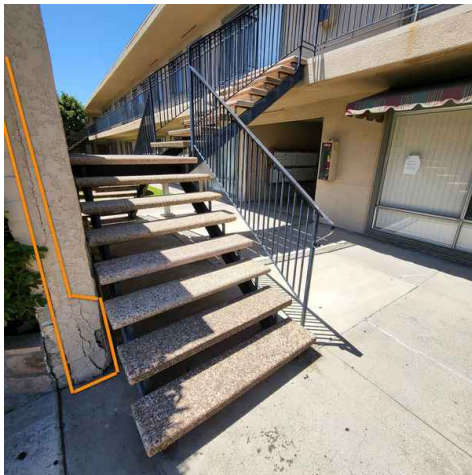

5.5.4 Middle Stairway

 Pass

**TERMITE/WOOD ROT DAMAGE**

Minor - There is minor evidence of wood boring insect intrusion and/or wood rot which may include bore-holes or tunnels, pellets and droppings, weakness, softness, live insects, discoloration, crumbling texture, or fungal growth. These condition(s) are minor, the affected components should be treated or replaced.

Recommendation

Contact a qualified professional.



5.6.1 Northwest Stairway



**DAMAGED PRECAST TREAD(S)**

Minor - Approximately 3 of 16 treads are cracked or broken. The affected stair treads appear to be the same age and are approaching the end of their service life, at a minimum the effected treads should be replaced, if not replaced a reinspection is recommended in two years.

Recommendation

Contact a qualified professional.



5.6.2 Northwest Stairway



**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.



5.7.1 West Walkway





**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Recommendation

Contact a qualified professional.

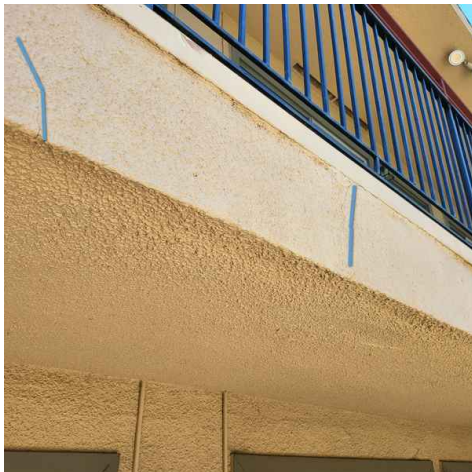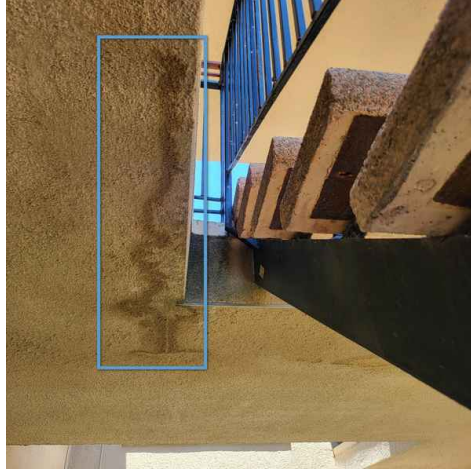

5.7.2 West Walkway





**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.

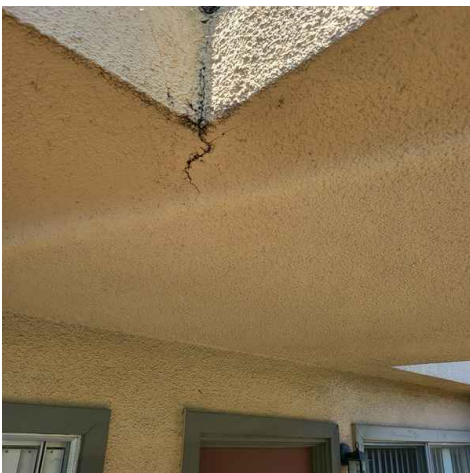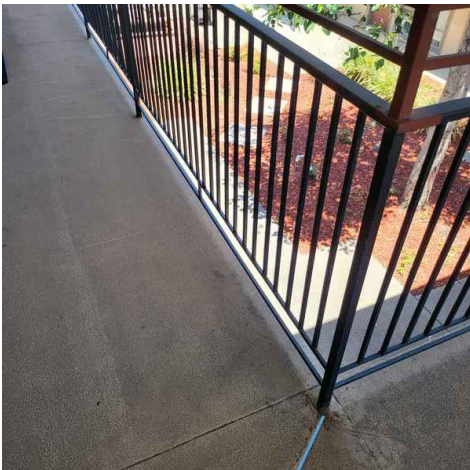

5.7.3 West Walkway

Non-Emergency Repairs Required

**CORROSION**

Marginal - There is significant corrosion that is affecting structural integrity. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Recommendation

Contact a qualified professional.



5.7.4 West Walkway

Pass


**UNSEALED CONNECTION(S)**

WHERE THE RAILING ATTACHES TO THE STAIR TREAD.

There are unsealed connections. A poor seal at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.

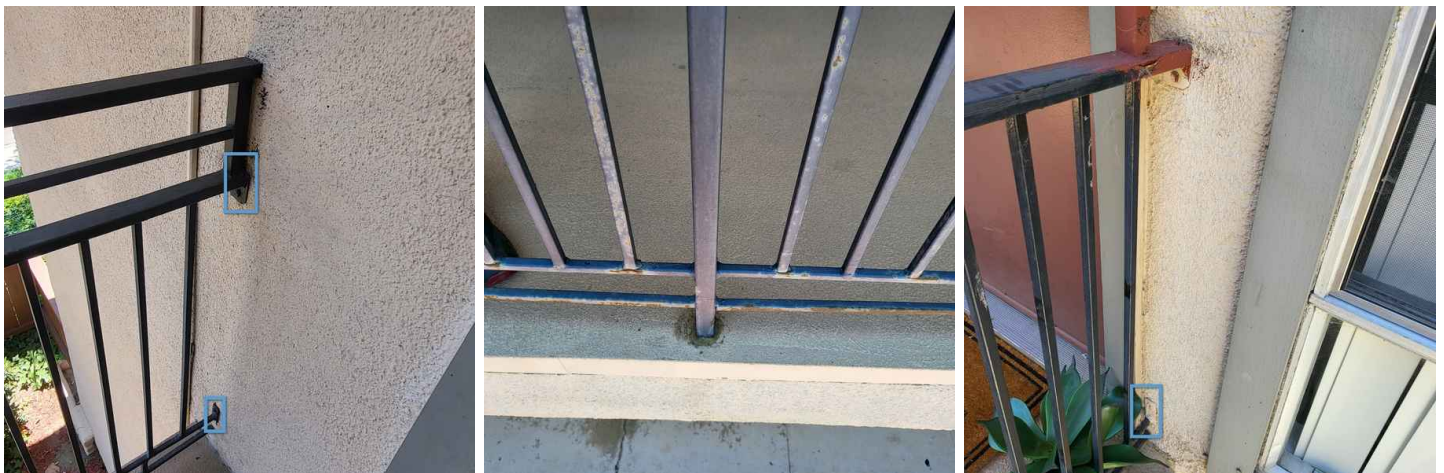

## 6: BUILDING 2: BALCONIES

6.1	Overall Condition Evaluation
6.2	Apt. 8 Balcony
6.3	Apt. 10 Balcony
6.4	Apt. 12 Balcony
6.5	Apt. 14 Balcony
6.6	Apt. 16 Balcony
6.7	Apt. 18 Balcony
6.8	Apt. 20 Balcony 1
6.9	Apt. 20 Balcony 2
6.10	Apt. 22 Balcony
6.11	Apt. 24 Balcony
6.12	Apt. 26 Balcony
6.13	Apt. 28 Balcony
6.14	Apt. 30 Balcony
6.15	Apt. 32 Balcony
6.16	Apt. 34 Balcony
6.17	Apt. 36 Balcony
6.18	Apt. 38 Balcony 1
6.19	Apt. 38 Balcony 2

### Information

**\*Orientation Images**

Balcony



**Apt. 8 Balcony : \*Balcony Inspection Image(s)**

**Apt. 8 Balcony : Approximate**

**Height**

9 ft

**Apt. 8 Balcony : Rail Material**

Steel

**Apt. 8 Balcony : Walking Surface**

**Material**

Composite

**Apt. 8 Balcony : Support Material**

Wood



**Apt. 10 Balcony : Approximate Height**  
9 ft

**Apt. 10 Balcony : Walking Surface Material**  
Composite

**Apt. 10 Balcony : Rail Material**  
Steel

**Apt. 10 Balcony : Support Material**  
Wood

**Apt. 10 Balcony : \*Balcony Inspection Image(s)**



**Apt. 12 Balcony : Approximate Height**  
9 ft

**Apt. 12 Balcony : Rail Material**  
Steel

**Apt. 12 Balcony : \*Balcony Inspection Image(s)**

**Apt. 12 Balcony : Walking Surface Material**  
Composite

**Apt. 12 Balcony : Support Material**  
Wood


**Apt. 14 Balcony : Approximate Height**  
9 ft

**Apt. 14 Balcony : Walking Surface Material**  
Composite

**Apt. 14 Balcony : Rail Material**  
Steel

**Apt. 14 Balcony : Support Material**  
Wood

**Apt. 14 Balcony : \*Balcony Inspection Image(s)**

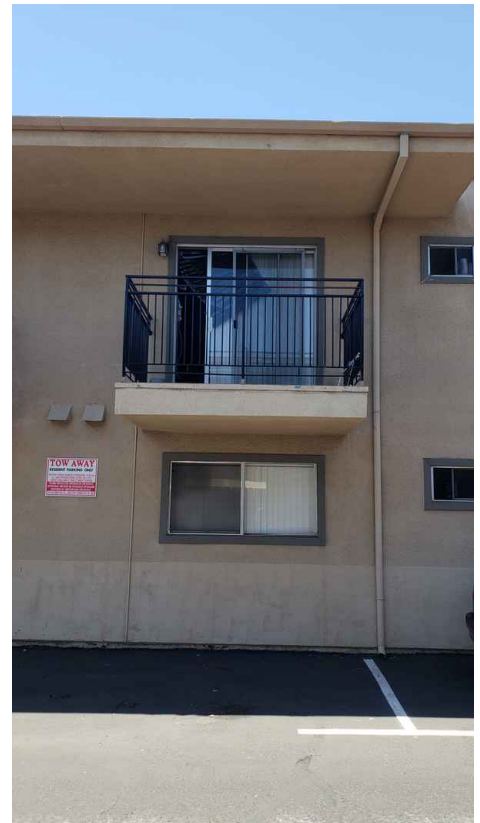

**Apt. 16 Balcony : Approximate Height**  
9 ft

**Apt. 16 Balcony : Walking Surface Material**  
Composite

**Apt. 16 Balcony : Rail Material**  
Steel

**Apt. 16 Balcony : Support Material**  
Wood

**Apt. 16 Balcony : \*Balcony Inspection Image(s)**



**Apt. 18 Balcony : Approximate Height**  
9 ft

**Apt. 18 Balcony : Rail Material**  
Steel

**Apt. 18 Balcony : \*Balcony Inspection Image(s)**

**Apt. 18 Balcony : Walking Surface Material**  
Composite

**Apt. 18 Balcony : Support Material**  
Wood

**Apt. 20 Balcony 1: Approximate Height**  
9 ft


**Apt. 20 Balcony 1: Walking Surface Material**  
Composite

**Apt. 20 Balcony 1: Rail Material**  
Steel

**Apt. 20 Balcony 1: Support Material**  
Wood


**Apt. 20 Balcony 1: \*Balcony Inspection Image(s)**



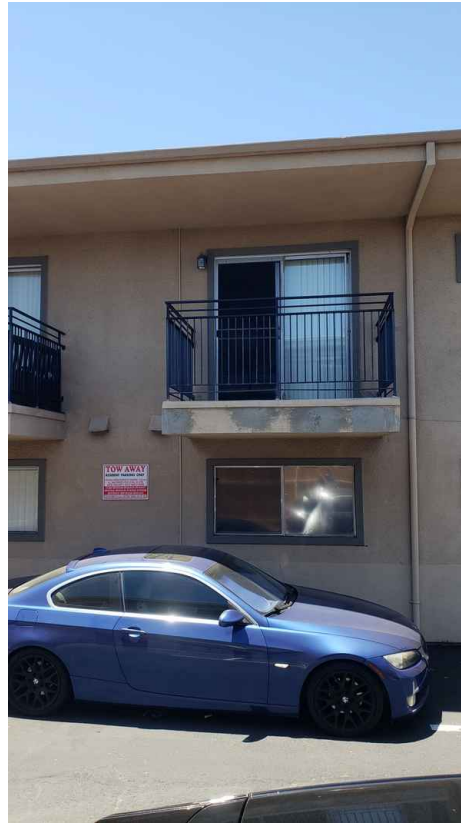

**Apt. 20 Balcony 2: Support Material**  
Wood

**Apt. 20 Balcony 2: \*Balcony Inspection Image(s)**

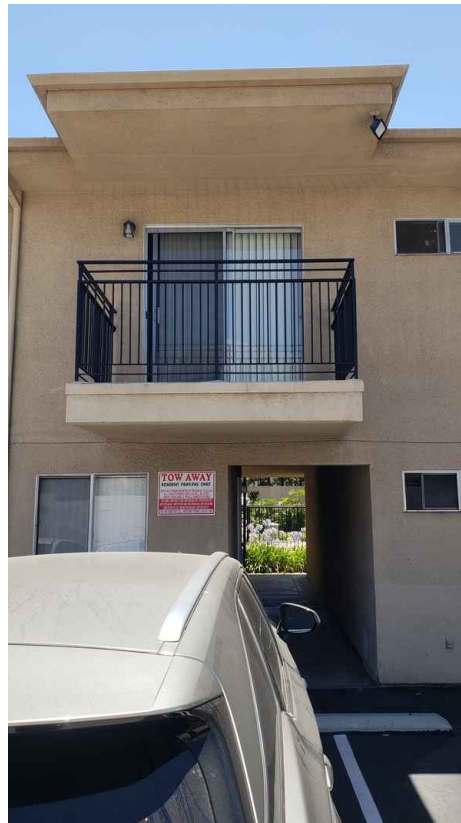

**Apt. 20 Balcony 2: Approximate Height**  
9 ft

**Apt. 20 Balcony 2: Walking Surface Material**  
Composite

**Apt. 20 Balcony 2: Rail Material**  
Steel


**Apt. 22 Balcony : Approximate Height**  
9 ft

**Apt. 22 Balcony : Walking Surface Material**  
Composite

**Apt. 22 Balcony : Rail Material**  
Steel

**Apt. 22 Balcony : Support Material**  
Wood

**Apt. 22 Balcony : \*Balcony Inspection Image(s)**

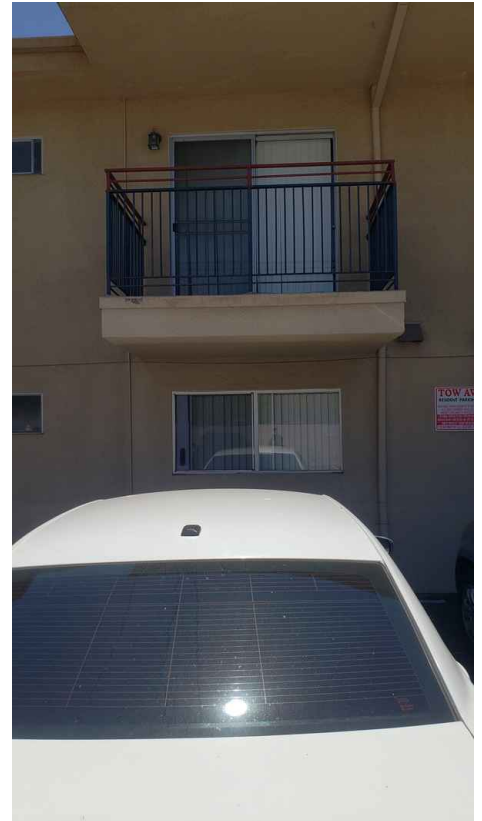

**Apt. 24 Balcony : Approximate Height**  
9 ft

**Apt. 24 Balcony : Walking Surface Material**  
Composite

**Apt. 24 Balcony : Rail Material**  
Steel

**Apt. 24 Balcony : Support Material**  
Wood

**Apt. 24 Balcony : \*Balcony Inspection Image(s)**



**Apt. 26 Balcony : Approximate Height**  
9 ft

**Apt. 26 Balcony : Rail Material**  
Steel

**Apt. 26 Balcony : \*Balcony Inspection Image(s)**

**Apt. 26 Balcony : Walking Surface Material**  
Composite

**Apt. 26 Balcony : Support Material**  
Wood



**Apt. 28 Balcony : Approximate Height**  
9 ft

**Apt. 28 Balcony : Walking Surface Material**  
Composite

**Apt. 28 Balcony : Rail Material**  
Steel

**Apt. 28 Balcony : Support Material**  
Wood

**Apt. 28 Balcony : \*Balcony Inspection Image(s)**

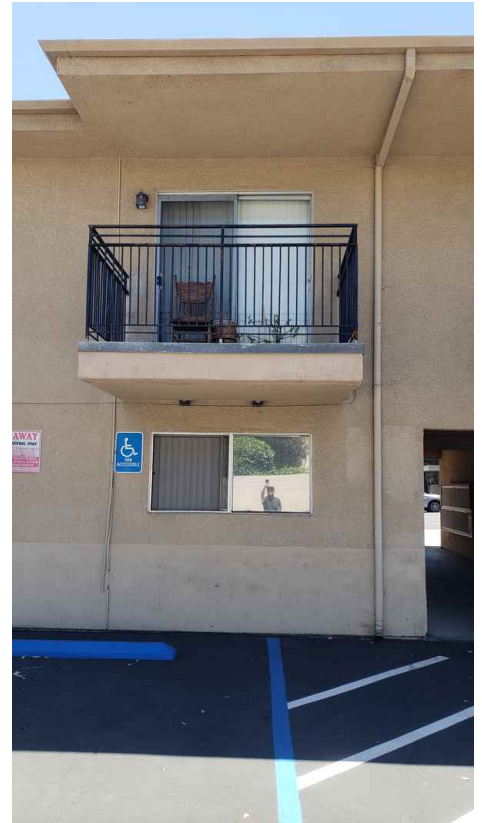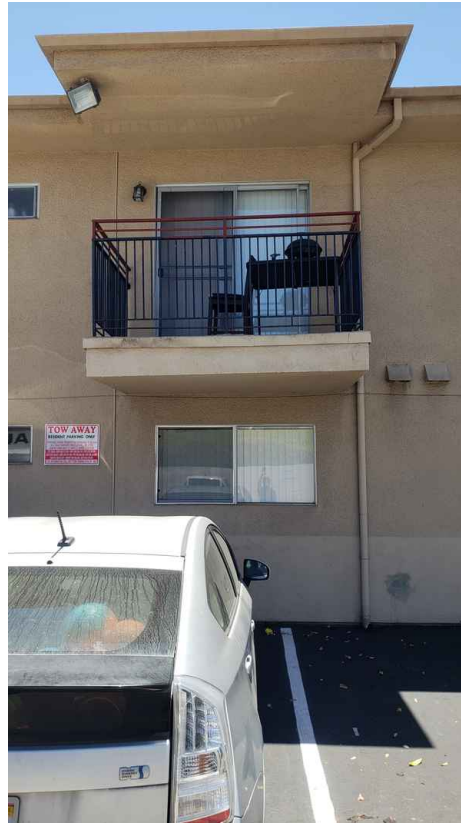

**Apt. 30 Balcony : Approximate Height**  
9 ft

**Apt. 30 Balcony : Walking Surface Material**  
Composite

**Apt. 30 Balcony : Rail Material**  
Steel

**Apt. 30 Balcony : Support Material**  
Wood

**Apt. 30 Balcony : \*Balcony Inspection Image(s)**



**Apt. 32 Balcony : Approximate Height**  
9 ft

**Apt. 32 Balcony : Rail Material**  
Steel

**Apt. 32 Balcony : \*Balcony Inspection Image(s)**

**Apt. 32 Balcony : Walking Surface Material**  
Composite

**Apt. 32 Balcony : Support Material**  
Wood



**Apt. 34 Balcony : Approximate Height**  
9 ft

**Apt. 34 Balcony : Walking Surface Material**  
Composite

**Apt. 34 Balcony : Rail Material**  
Steel

**Apt. 34 Balcony : Support Material**  
Wood

**Apt. 34 Balcony : \*Balcony Inspection Image(s)**

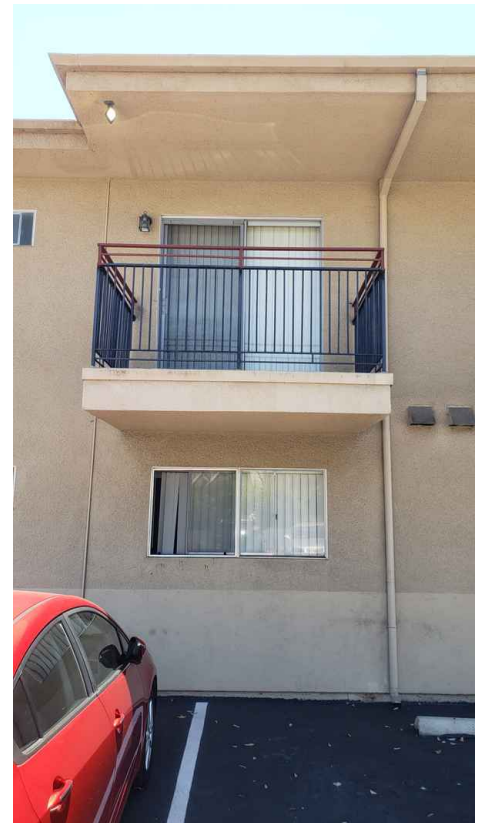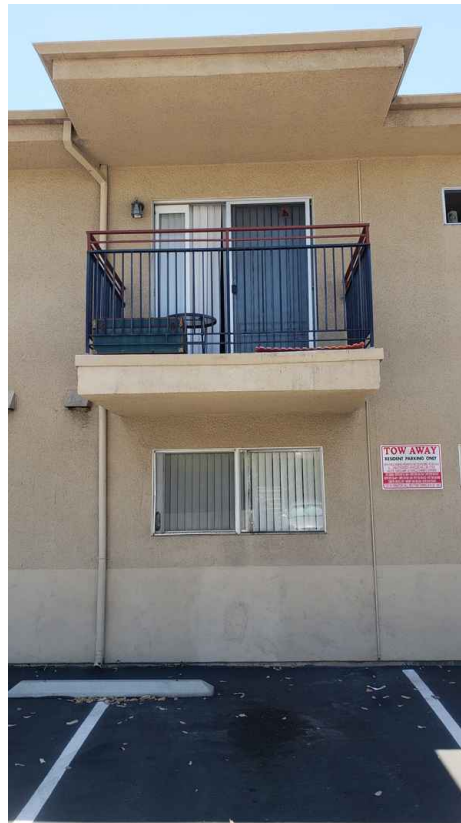

**Apt. 36 Balcony : Approximate Height**  
9 ft

**Apt. 36 Balcony : Walking Surface Material**  
Composite

**Apt. 36 Balcony : Rail Material**  
Steel

**Apt. 36 Balcony : Support Material**  
Wood

**Apt. 36 Balcony : \*Balcony Inspection Image(s)**



**Apt. 38 Balcony 1: Approximate Height**  
9 ft

**Apt. 38 Balcony 1: Walking Surface Material**  
Composite

**Apt. 38 Balcony 1: Rail Material**  
Steel

**Apt. 38 Balcony 1: Support Material**  
Wood

**Apt. 38 Balcony 1: \*Balcony Inspection Image(s)**


**Apt. 38 Balcony 2: Approximate Height**  
9 ft

**Apt. 38 Balcony 2: Walking Surface Material**  
Composite

**Apt. 38 Balcony 2: Rail Material**  
Steel

**Apt. 38 Balcony 2: Support Material**  
Wood

**Apt. 38 Balcony 2: \*Balcony Inspection Image(s)**

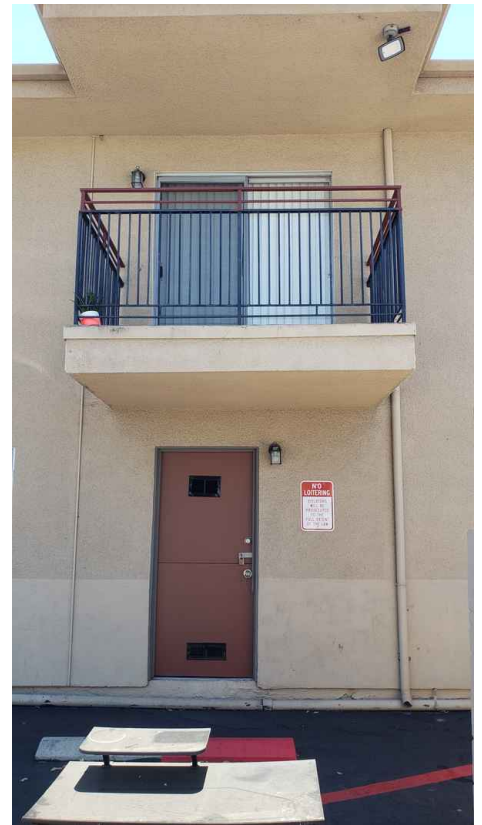

## Condition evaluation

### 6.1.1 Overall Condition Evaluation

#### **MARGINAL CONDITION**

##### **Marginal Condition - Non-Emergency Repairs Required:**

One or more components of this E3 group rated as Marginal, are deemed to be compromised and are not functioning as intended. This condition may evolve into a hazardous condition if unaddressed. The overall condition is determined by the component in the worst condition.

##### Recommendation

Contact a qualified professional.

 Non-Emergency Repairs Required

6.2.1 Apt. 8 Balcony



**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.



6.2.2 Apt. 8 Balcony




**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

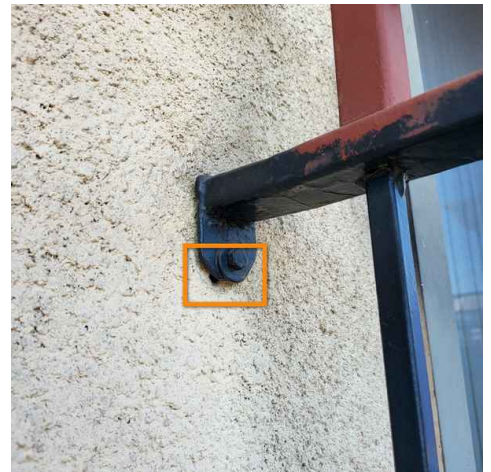

6.2.3 Apt. 8 Balcony



**SUPPORT CONSTRUCTION**

**EXCESSIVE SLANT**

Minor - The inspection revealed inadequate or improper construction, or evidence of instability in the support structure. This condition suggests that the support construction may not adhere to regulatory standards.

Recommendation

Contact a qualified professional.



6.3.1 Apt. 10 Balcony



**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



6.4.1 Apt. 12 Balcony




### OPENINGS IN WATERPROOFING

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

#### Recommendation

Contact a qualified professional.

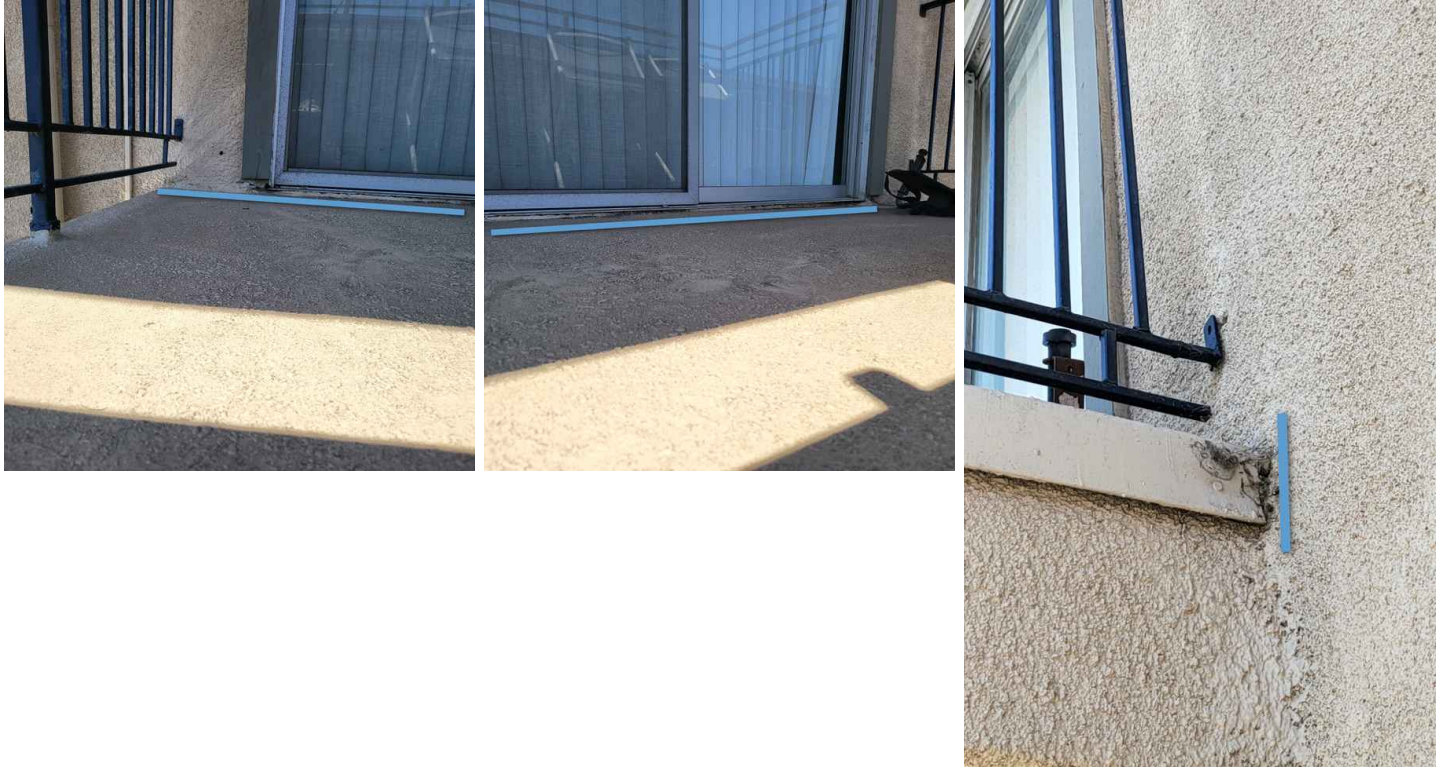



6.4.2 Apt. 12 Balcony

### MISSING OR LOOSE FASTENER(S)

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



Non-Emergency Repairs Required



6.5.1 Apt. 14 Balcony

### DAMAGED STUCCO




Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Recommendation

Contact a qualified professional.



Cracking and puffing

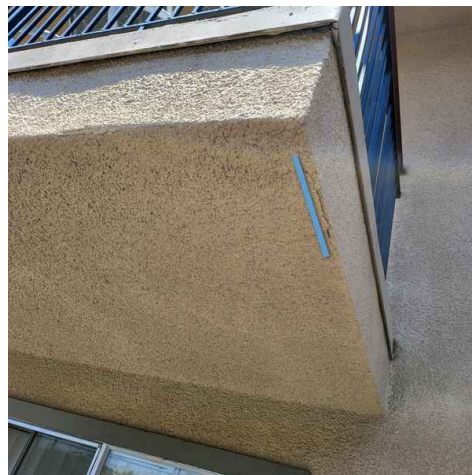

Cracking

6.5.2 Apt. 14 Balcony

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

Non-Emergency Repairs Required



6.6.1 Apt. 16 Balcony

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

Non-Emergency Repairs Required



6.7.1 Apt. 18 Balcony

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

Non-Emergency Repairs Required



6.8.1 Apt. 20 Balcony 1

 Non-Emergency Repairs Required

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



6.9.1 Apt. 20 Balcony 2

 Pass

**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.



6.9.2 Apt. 20 Balcony 2

**UNSEALED CONNECTION(S)**

WHERE THE RAILING ATTACHES TO THE STAIR TREAD.

There are unsealed connections. Lack of proper sealing at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.



6.9.3 Apt. 20 Balcony 2

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



6.10.1 Apt. 22 Balcony



**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.



6.11.1 Apt. 24 Balcony



### OPENINGS IN WATERPROOFING

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

#### Recommendation

Contact a qualified professional.



6.11.2 Apt. 24 Balcony



Non-Emergency Repairs Required


**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

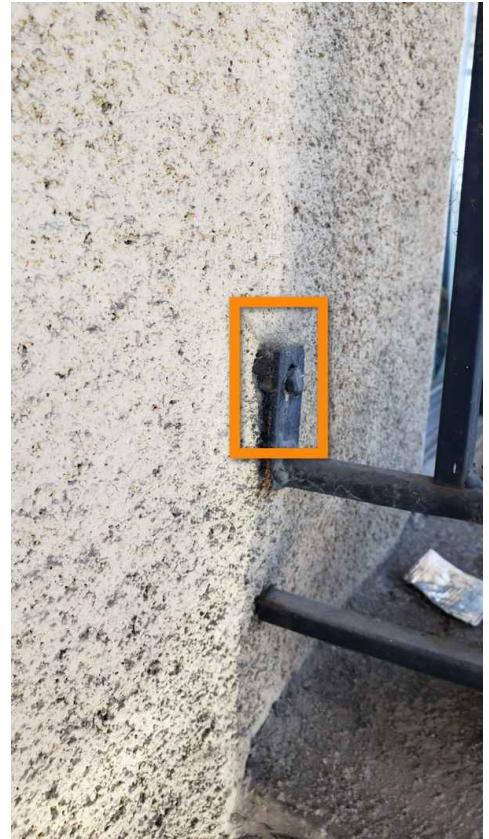

6.12.1 Apt. 26 Balcony



Non-Emergency Repairs Required


**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

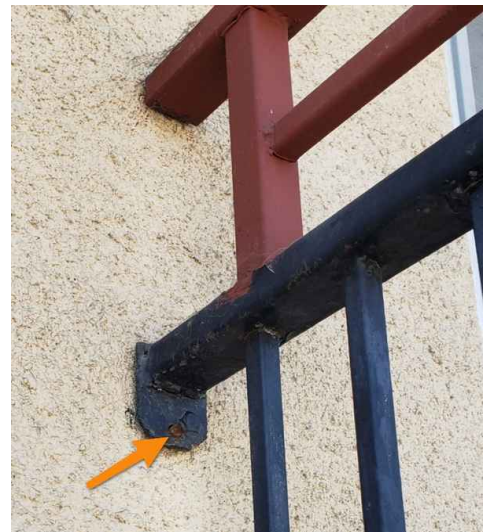

6.13.1 Apt. 28 Balcony



**UNSEALED CONNECTION(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

There are unsealed connections. A poor seal at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.

6.13.2 Apt. 28 Balcony

Non-Emergency Repairs Required


**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

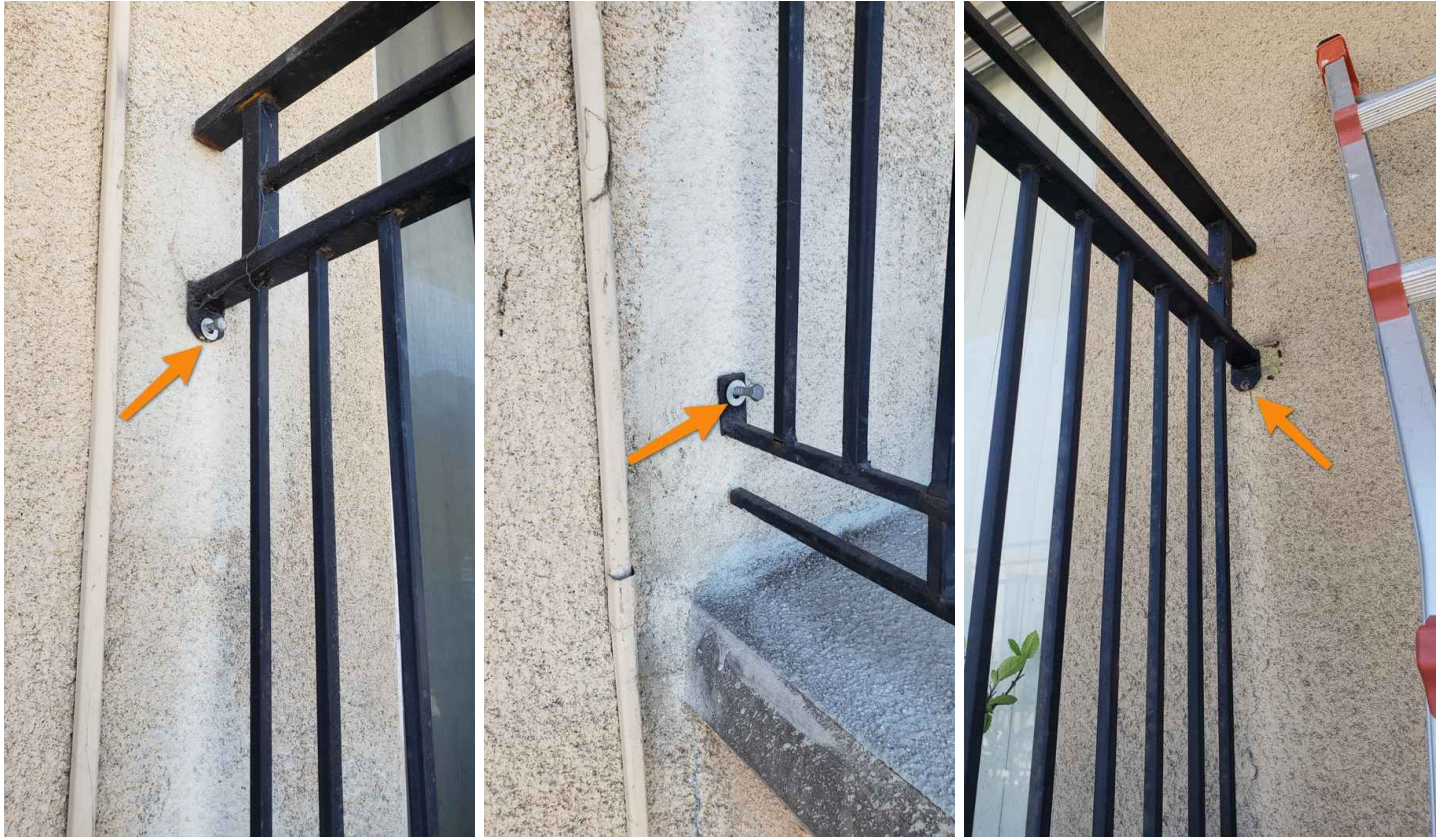



6.14.1 Apt. 30 Balcony




### OPENINGS IN WATERPROOFING

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.

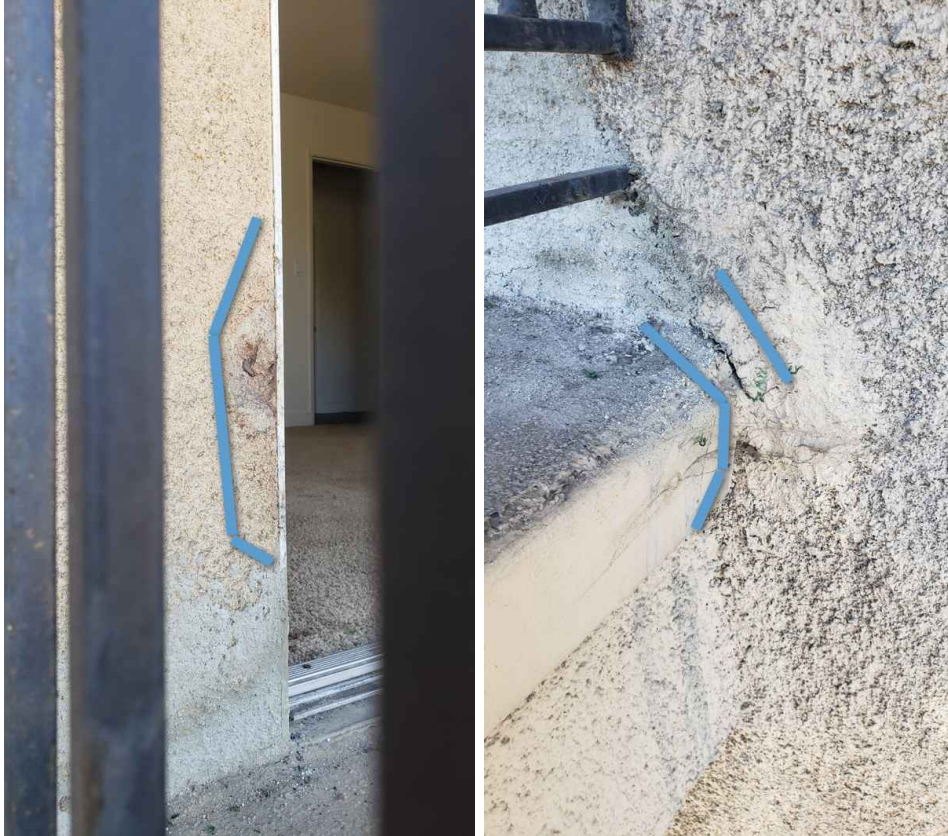

6.14.2 Apt. 30 Balcony

Non-Emergency Repairs Required

**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



6.15.1 Apt. 32 Balcony




**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.

Recommendation

Contact a qualified professional.

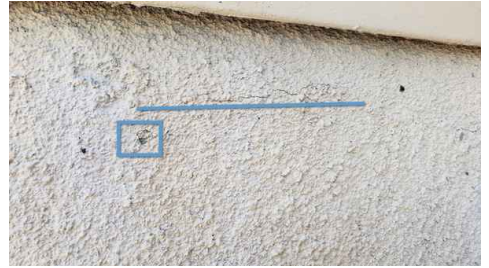

6.15.2 Apt. 32 Balcony



### **OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

#### Recommendation

Contact a qualified professional.



6.15.3 Apt. 32 Balcony

Non-Emergency Repairs Required

**CORROSION**

Marginal - There is significant corrosion that is affecting structural integrity. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Recommendation

Contact a qualified professional.



expansion from corrosion



expansion from corrosion

6.16.1 Apt. 34 Balcony



**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.



6.16.2 Apt. 34 Balcony



**MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.



6.17.1 Apt. 36 Balcony



### OPENINGS IN WATERPROOFING

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

#### Recommendation

Contact a qualified professional.







6.17.2 Apt. 36 Balcony



### UNSEALED CONNECTION(S)

WHERE THE RAILING ATTACHES TO THE WALKING SURFACE.

There are unsealed connections. Lack of proper sealing at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.



6.18.1 Apt. 38 Balcony 1



### OPENINGS IN WATERPROOFING

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

#### Recommendation

Contact a qualified professional.



6.18.2 Apt. 38 Balcony 1

Non-Emergency Repairs Required

**CORROSION**

Marginal - There is significant corrosion that is affecting structural integrity. A Phase 2 Pre-721 Evaluation (P2PE) is recommended to formulate a detailed repair plan. See Reference Information: Notification and Follow Up - Marginal.

Recommendation

Contact a qualified professional.



6.18.3 Apt. 38 Balcony 1




### UNSEALED CONNECTION(S)

WHERE THE RAILING ATTACHES TO THE WALKING SURFACE.

There are unsealed connections. Lack of proper sealing at these junctions raises concerns about potential water intrusion. These connections should be sealed

Recommendation

Contact a qualified professional.

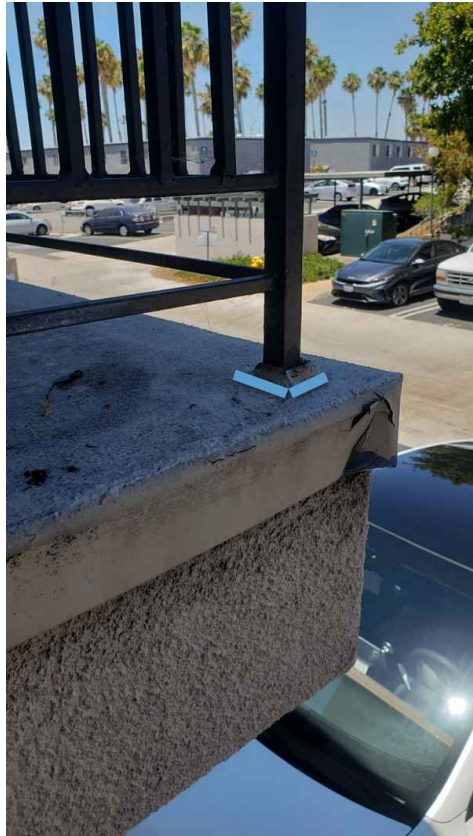

6.19.1 Apt. 38 Balcony 2



**DAMAGED STUCCO**

Minor - Stucco is cracking, stained, bulging, bubbling, blistering, efflorescing, soft, crumbling, discolored or showing signs of mold and mildew. These condition(s) are minor, and can be addressed as maintenance items.



Recommendation

Contact a qualified professional.

6.19.2 Apt. 38 Balcony 2




**OPENINGS IN WATERPROOFING**

Minor - There are cracks, openings, or penetrations in the waterproofing. The affected areas should be sealed.

Recommendation

Contact a qualified professional.

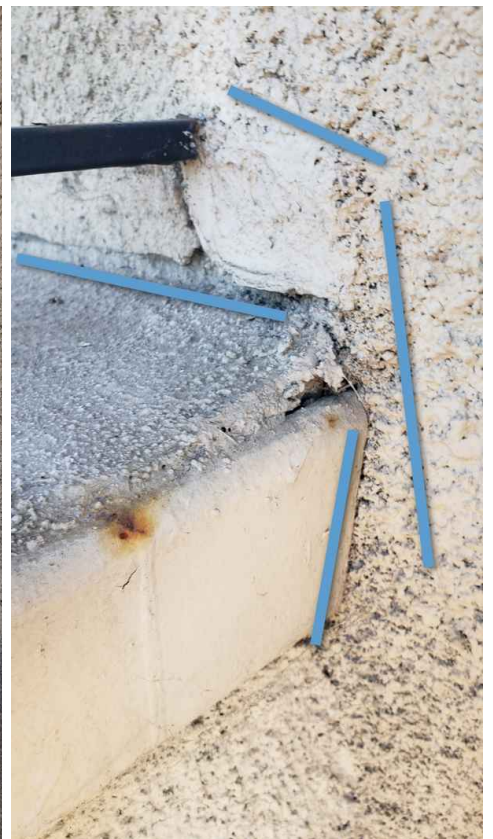

6.19.3 Apt. 38 Balcony 2

### **MISSING OR LOOSE FASTENER(S)**

WHERE THE RAILING ATTACHES TO THE WALL.

Hardware is loose or missing from railing connections. Appropriate hardware must be installed and loose hardware tightened prior to SB-721 Inspection.

Recommendation

Contact a qualified professional.

 Non-Emergency Repairs Required

